

General Information

Date & Time: 25, May, 2026 15:40

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	148,877
Registration No.	DBG7646	Chassis No.	PA1B18F35P4202491
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



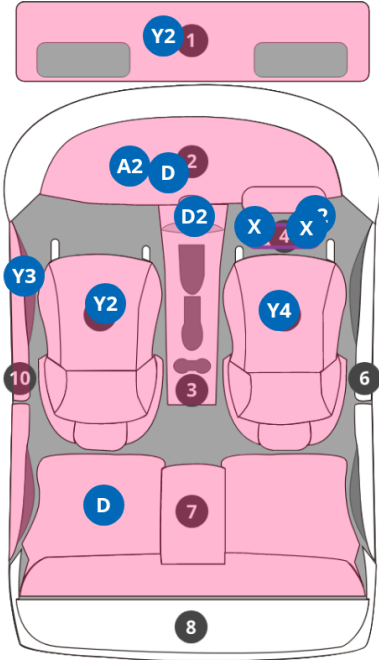
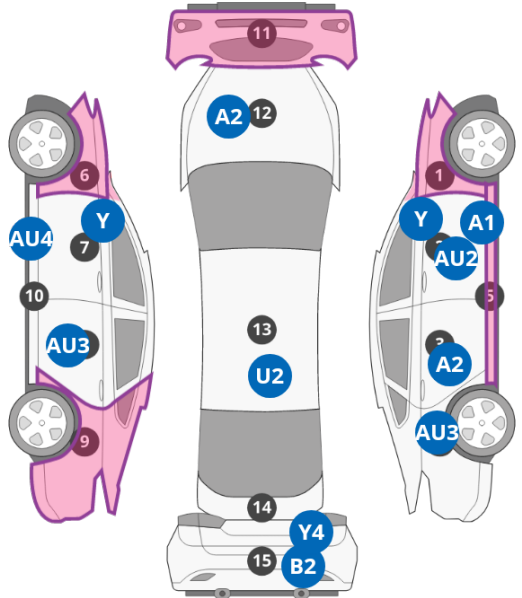
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	111	117	110
2	Boot Lid	167.6	163	162	178
3	Roof	99.7	103	105	96/95
4	Left Front Fender	373.3	231	432	457
5	Left Front Door	108.6	108	112	106
6	Center Panel Left				
7	Left Rear Door	111.6	116	109	110
8	Left Back Panel	168.6	111	281	114
9	Right Front Fender	220.0	190	206	264
10	Right Front Door	106.0	98	110	110
11	Center Panel Right				
12	Right Rear Door	112.6	120	109	109
13	Right Back Panel	113.0	106	108	125

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Loose, Deformed - Small / (R) Front Floor Mat - Loose, Deformed - Small / (L) Front Floor Mat - Missing - Yes / (R) Front Seat - Grime - Large / (L) Front Trim - Grime - Medium / Rear Seat - Repair Mark - Yes / (L) Front Seat - Grime - Small / Ceiling - Grime - Small / Steering Wheel - Worn, Peel, Crack - Small / Mat Other - Missing - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Replaced - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Mirror - Crack - Damaged / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Rear Bumper, Lamps, Panels - Modified - Small / Trunk Hood, Rear Gate - Crack, Gap - Large / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Mirror - Crack - Damaged / Roof - Dent - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Difference in Color / Bonnet, Headlight - Scratch - Small
Frame Evaluation : B	Functional Evaluation : E
Remarks Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes	Remarks Warning Lamps - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with Ito plate/air-conditioned issue/with engine and transmission unusual noise/headlight and tail light issue/break light issue/check engine lamp on/traction control lamp on/maintenance light on/abs lamp on/no spare key/no tools and jack/no spare tire/no reverse camera