

General Information

Date & Time: 23, May, 2026 15:47

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	25,900
Registration No.	DCA5096	Chassis No.	PA1B18F39S4292351
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



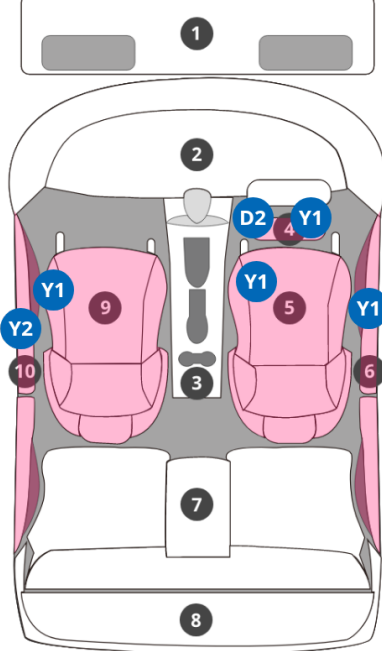
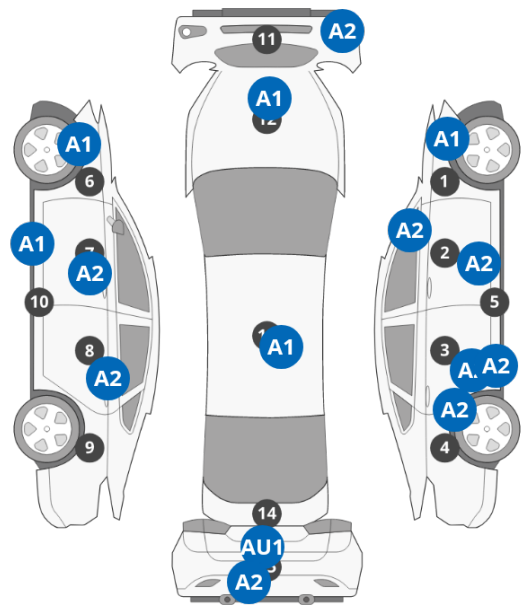
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.0	107	115	108
2	Boot Lid	110.6	111	113	108
3	Roof	109.2	114	109	104/110
4	Left Front Fender	108.3	113	103	109
5	Left Front Door	107.3	103	107	112
6	Center Panel Left				
7	Left Rear Door	106.3	111	106	102
8	Left Back Panel	115.3	114	117	115
9	Right Front Fender	108.0	104	102	118
10	Right Front Door	106.0	112	102	104
11	Center Panel Right				
12	Right Rear Door	107.6	104	106	113
13	Right Back Panel	114.0	113	107	122

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Minimal / (R) Front Floor Mat - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Minimal / (L) Front Floor Mat - Worked - Small / (R) Front Seat - Grime - Minimal	Remarks (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes

with LTO plate/with warranty booklet/with incomplete tools with jack/with spare tire/hairline scratches on the body