

General Information

Date & Time: 23, May, 2026 08:12

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	35,652
Registration No.	EAJ6358	Chassis No.	PA1B18F35R4266226
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



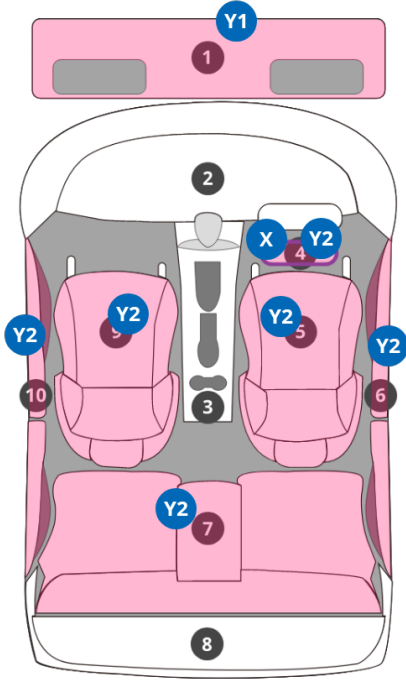
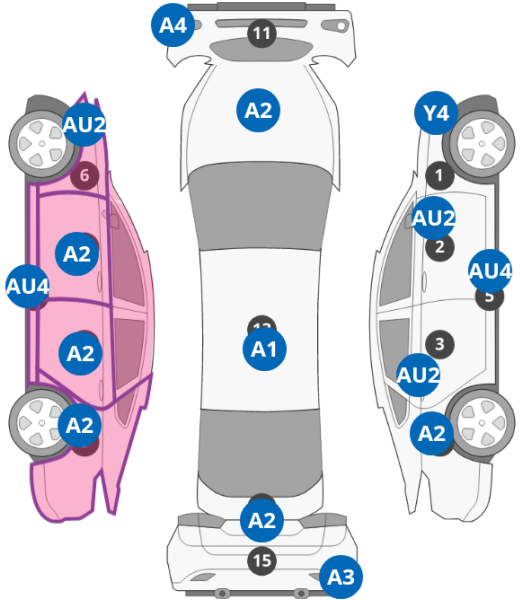
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.0	106	111	107
2	Boot Lid	114.0	108	117	117
3	Roof	105.7	108	111	103/101
4	Left Front Fender	488.3	252	680	533
5	Left Front Door	401.6	454	473	278
6	Center Panel Left				
7	Left Rear Door	247.0	284	216	241
8	Left Back Panel	171.6	195	179	141
9	Right Front Fender	104.0	100	100	112
10	Right Front Door	102.3	103	103	101
11	Center Panel Right				
12	Right Rear Door	101.8	105	104	97
13	Right Back Panel	110.6	106	108	118

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Missing - Yes / (L) Front Seat - Grime - Small / Ceiling - Grime - Minimal	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Fender, Molding - Crack, Gap - Large / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/with warranty booklet/with incomplete tools no jack/with spare tire/headlight issue/park light issue/signal light issue/headlight cover issue/traction control indicator on/hairline scratches on the body/signal light issue