

General Information

Date & Time: 23, May, 2026 06:43

Make	Toyota	Model	Raize
YOM	2023	Odo Meter Reading	59,467
Registration No.	NEE2629	Chassis No.	MHKAB1BA6NJ030833
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	Gray		

Body / Panel Condition



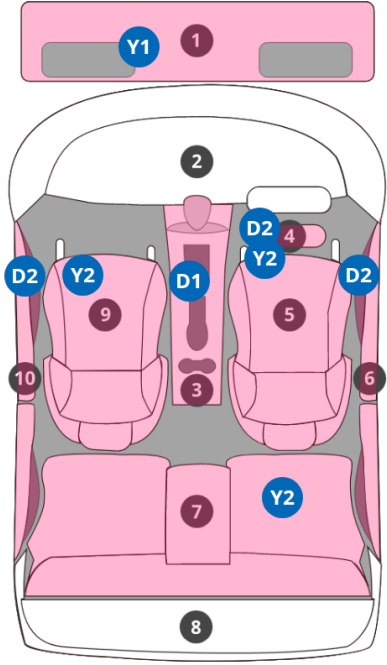
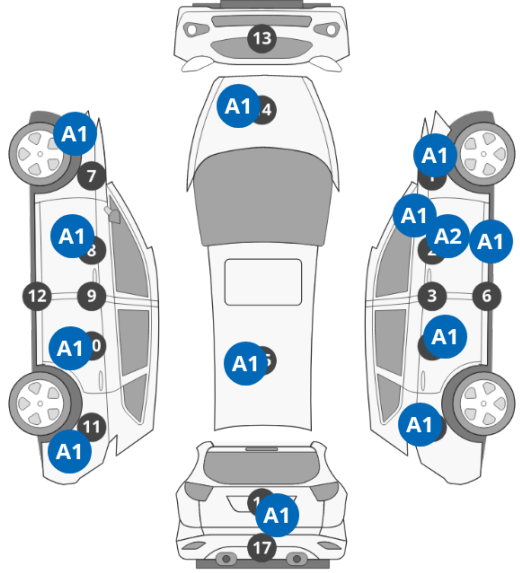
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.1	109	88	116
2	Boot Lid	117.0	106	125	120
3	Roof	99.0	90	101	101/104
4	Left Front Fender	96.3	90	100	99
5	Left Front Door	97.3	100	99	93
6	Center Panel Left				
7	Left Rear Door	97.2	93	102	96
8	Left Back Panel	91.3	87	97	90
9	Right Front Fender	96.7	94	118	78
10	Right Front Door	96.9	83	105	103
11	Center Panel Right				
12	Right Rear Door	86.9	88	84	89
13	Right Back Panel	85.2	83	90	83

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / (L) Front Seat - Grime - Small / (R) Front Floor Mat - Worked - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (R) Front Trim - Worked - Small / (L) Front Trim - Worked - Small / Console, Switchs, Vents - Worked - Minimal	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / Roof - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes
with Ito plate/with spare tire/no tools and jack/with dashcam/with manual and warranty booklet/with hairlines scratches on the body/engine unusual sound/no spare key