

General Information

Date & Time: 23, May, 2026 08:22

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	8,335
Registration No.	NEK6060	Chassis No.	PA1B18F37S4287861
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



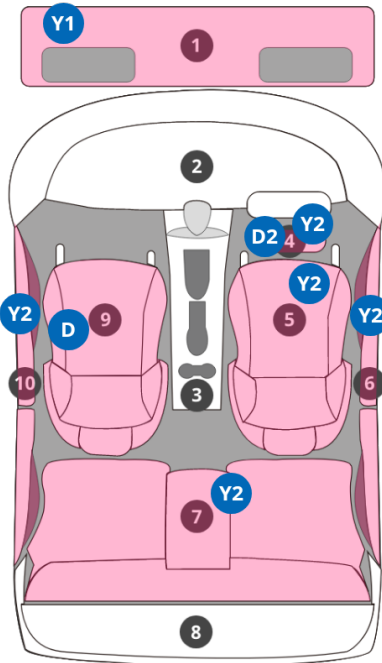
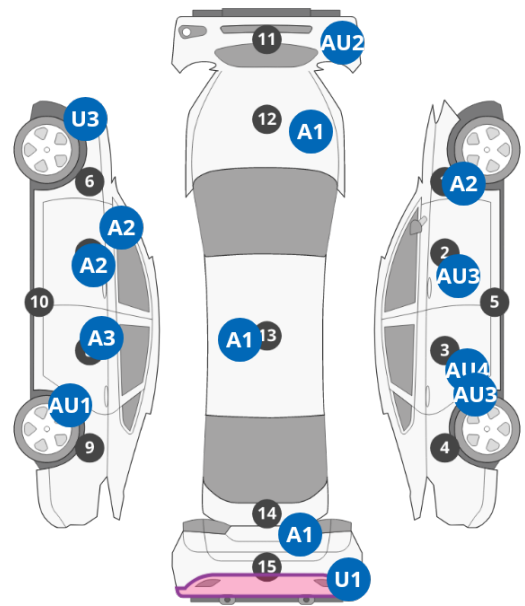
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.0	113	112	108
2	Boot Lid	115.0	114	111	120
3	Roof	97.4	104	96	95/94
4	Left Front Fender	106.0	101	103	114
5	Left Front Door	100.2	100	100	101
6	Center Panel Left				
7	Left Rear Door	124.0	121	113	138
8	Left Back Panel	106.6	111	106	103
9	Right Front Fender	99.5	97	103	99
10	Right Front Door	95.6	98	93	95
11	Center Panel Right				
12	Right Rear Door	138.0	141	132	141
13	Right Back Panel	256.6	186	334	250

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Worn - Yes / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Small / Ceiling - Grime - Minimal / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small	Remarks (R) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, no jack and tools, with spare tire, with LTO plate, scratches on tail light