

General Information

Date & Time: 23, May, 2026 19:47

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	59,205
Registration No.	GBJ5870	Chassis No.	MHFAA1BY8S0038870
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Red Mica Metallic		

Body / Panel Condition



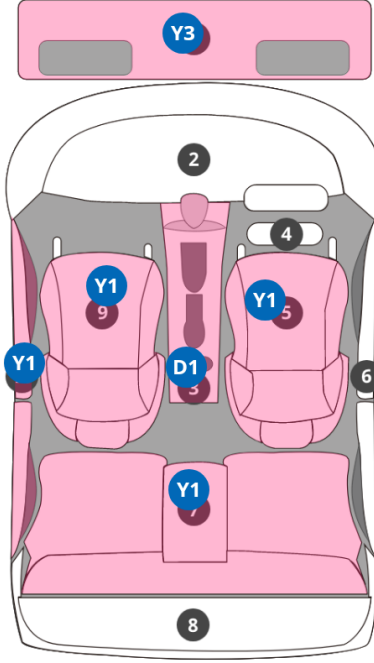
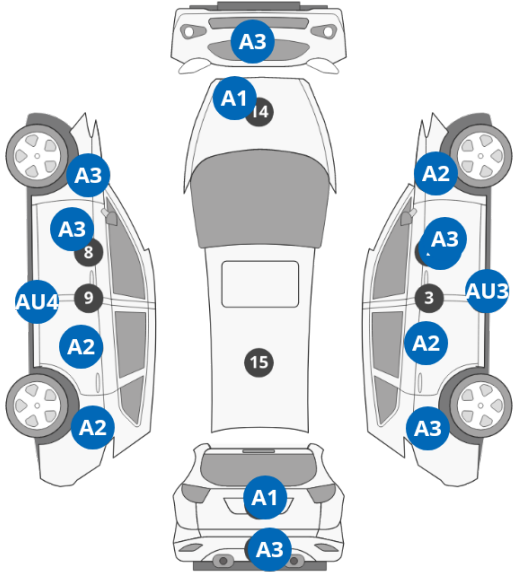
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.0	111	126	126
2	Boot Lid	111.3	116	117	101
3	Roof	122.5	125	144	108/113
4	Left Front Fender	128.2	93	111	181
5	Left Front Door	126.3	130	124	125
6	Center Panel Left				
7	Left Rear Door	124.3	123	121	129
8	Left Back Panel	122.6	132	127	109
9	Right Front Fender	108.6	105	114	107
10	Right Front Door	123.3	129	124	117
11	Center Panel Right				
12	Right Rear Door	122.0	121	120	125
13	Right Back Panel	122.6	111	125	132

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B		Exterior Evaluation : E	
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks Console, Switchs, Vents - Loose, Deformed - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / Ceiling - Grime - Medium / (L) Front Trim - Grime - Minimal		Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium	
Frame Evaluation : A		Functional Evaluation : B	
Remarks Defects not found		Remarks Battery - Weak - Yes	

Inspector Notes

With LTO plate, no warranty booklet, with spare key 1pc, with spare tire, 4 old tires are intact, no tools, no jack, no seat cover, with hairline scratches.