

General Information

Date & Time: 23, May, 2026 08:13

Make	Toyota	Model	Raize
YOM	2022	Odo Meter Reading	38,375
Registration No.	NFE3605	Chassis No.	MHKAB1BA8NJ018506
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



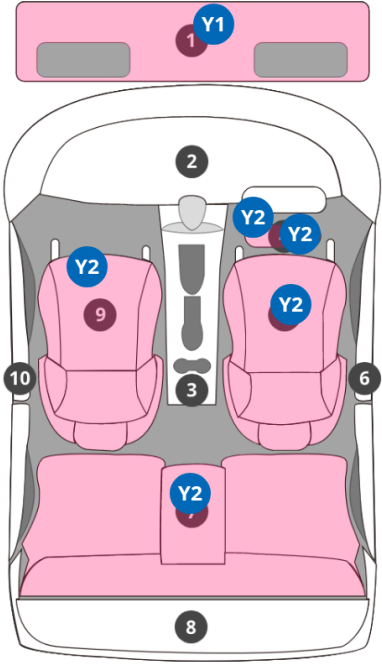
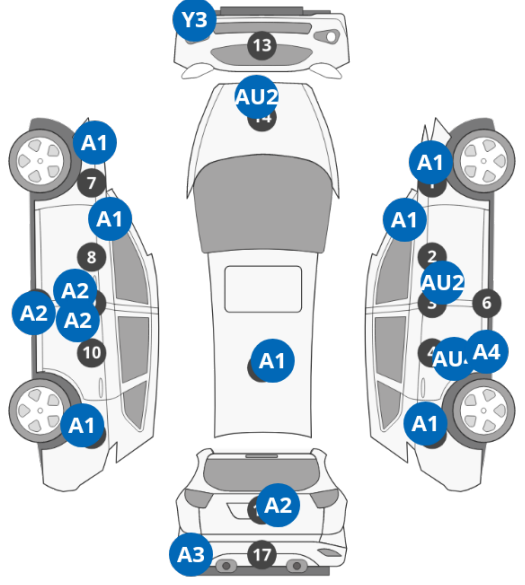
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.7	97	96	106
2	Boot Lid	86.0	85	89	84
3	Roof	89.2	100	99	79/79
4	Left Front Fender	94.6	87	107	90
5	Left Front Door	94.7	92	100	93
6	Center Panel Left				
7	Left Rear Door	88.5	88	90	88
8	Left Back Panel	85.3	83	82	91
9	Right Front Fender	91.3	85	105	84
10	Right Front Door	99.7	95	105	99
11	Center Panel Right				
12	Right Rear Door	96.8	100	92	99
13	Right Back Panel	82.1	92	76	79

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Small / (L) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Minimal	Remarks (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Large / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with warranty booklet/with incomplete tools with jack/with spare tire/hairline scratches on the body/with seat cover/no reverse camera