

General Information

Date & Time: 22, May, 2026 15:49

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	11,477
Registration No.	NFR9434	Chassis No.	PA1B18F36R4256577
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



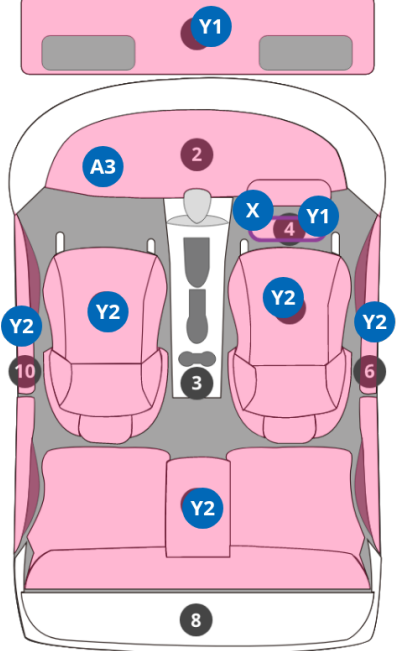
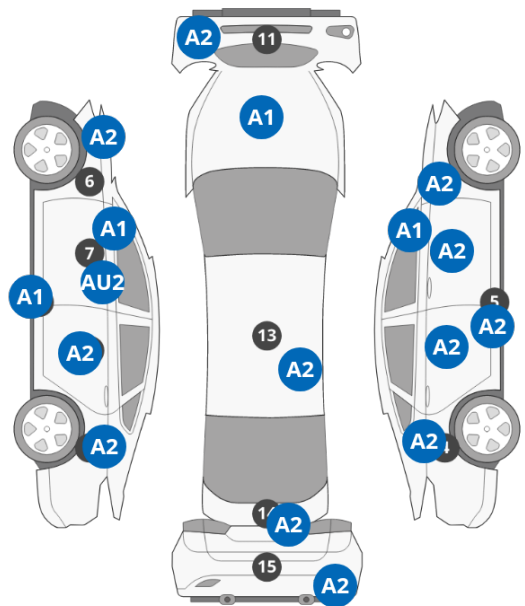
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.3	105	106	105
2	Boot Lid	108.0	101	110	113
3	Roof	99.6	102	96	95/106
4	Left Front Fender	106.3	112	101	106
5	Left Front Door	103.6	99	111	101
6	Center Panel Left				
7	Left Rear Door	100.5	107	103	92
8	Left Back Panel	116.6	123	115	112
9	Right Front Fender	101.1	105	99	100
10	Right Front Door	111.3	108	109	117
11	Center Panel Right				
12	Right Rear Door	107.0	102	105	114
13	Right Back Panel	111.6	102	108	125

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Minimal / Rear Seat - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Missing - Yes / Ceiling - Grime - Minimal / (L) Front Seat - Grime - Small / Instrument Panel - Worn, Scratch, Cut, Crack - Medium	Remarks (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
without LTO plate/no warranty booklet/no tools and jack/with spare tire/rear seat belts missing/hairline scratches on the body