

General Information

Date & Time: 22, May, 2026 15:54

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	9,668
Registration No.	NJF7027	Chassis No.	MHKAA1BC3SJ037660
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



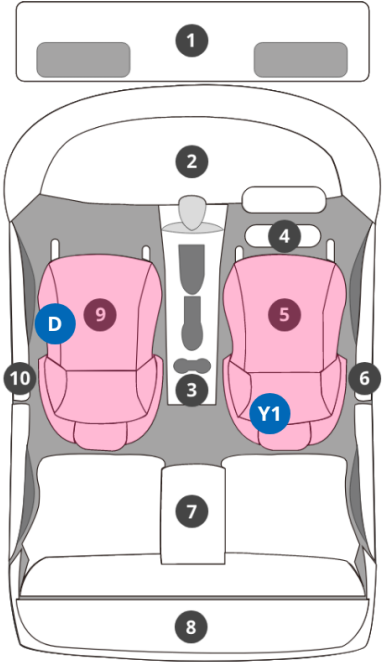
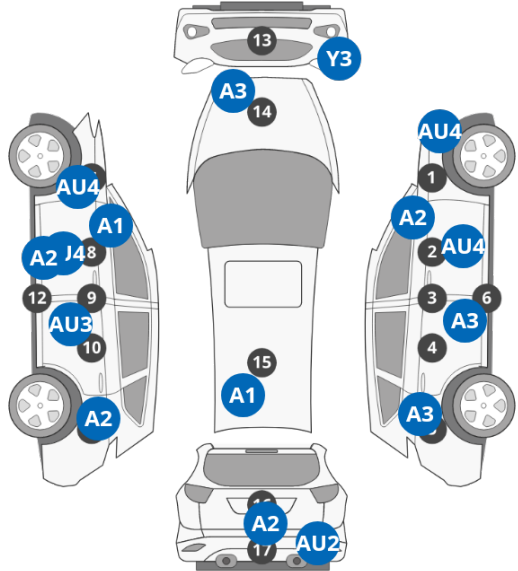
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.3	110	116	123
2	Boot Lid	110.0	112	100	118
3	Roof	104.0	109	101	101/105
4	Left Front Fender	112.3	114	111	112
5	Left Front Door	111.0	119	102	112
6	Center Panel Left				
7	Left Rear Door	109.3	106	113	109
8	Left Back Panel	114.3	116	110	117
9	Right Front Fender	108.6	102	114	110
10	Right Front Door	107.6	116	106	101
11	Center Panel Right				
12	Right Rear Door	107.3	111	101	110
13	Right Back Panel	107.0	110	100	111

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Medium / Roof - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

with warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail light,