

General Information

Date & Time: 23, May, 2026 15:40

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	31,059
Registration No.	NKL4075	Chassis No.	PA1B18F34R4280893
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



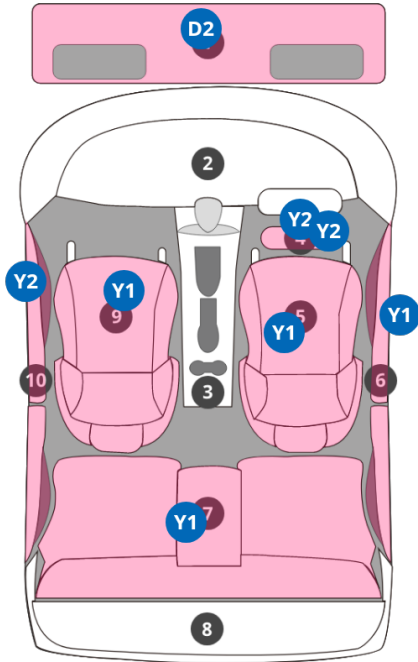
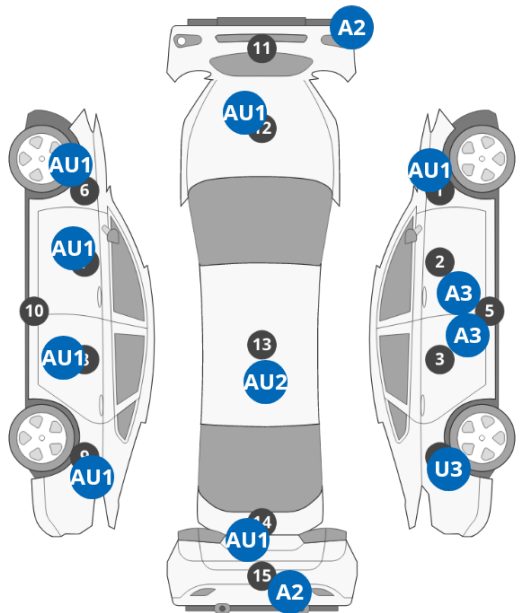
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.0	117	114	132
2	Boot Lid	157.0	133	194	144
3	Roof	119.5	120	116	122/120
4	Left Front Fender	107.3	113	107	102
5	Left Front Door	118.0	114	119	121
6	Center Panel Left				
7	Left Rear Door	114.3	122	114	107
8	Left Back Panel	121.6	134	119	112
9	Right Front Fender	114.3	123	115	105
10	Right Front Door	121.6	121	119	125
11	Center Panel Right				
12	Right Rear Door	120.0	127	116	117
13	Right Back Panel	121.0	123	117	123

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Minimal / Ceiling - Crinkle - Small / (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small	Remarks Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / Bonnet, Headlight - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with spare tire, with jack, with reverse camera, with manual and warranty booklet, no tools, scratches and dent on exterior, scratches on taillight and headlight.