

General Information

Date & Time: 23, May, 2026 19:53

Make	Toyota	Model	Hilux
YOM	2025	Odo Meter Reading	27,300
Registration No.	KBE9218	Chassis No.	MR0CB8CD0S4500256
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



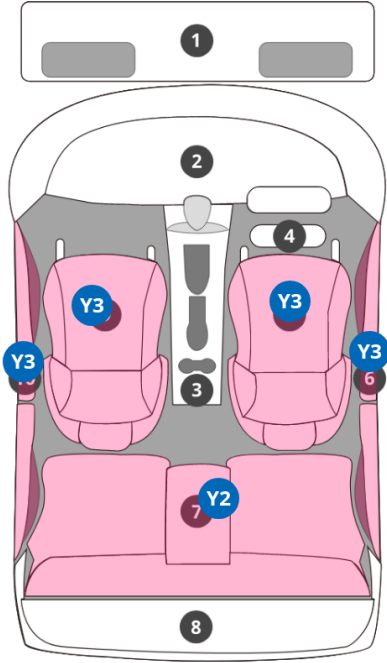
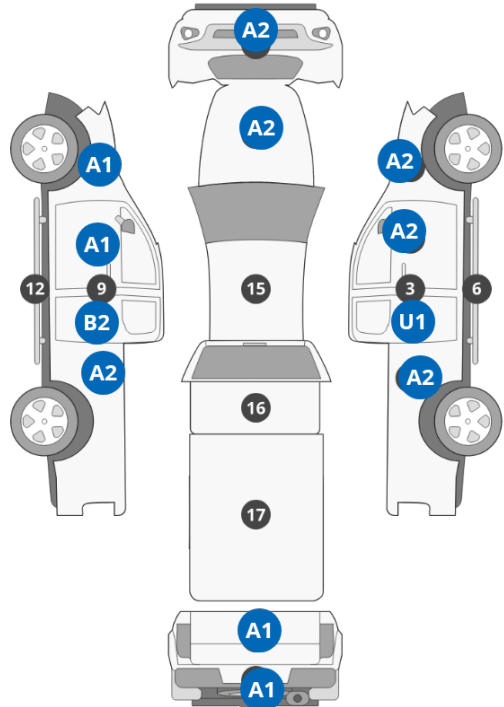
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.0	118	118	121
2	Boot Lid	102.4	95	111	101
3	Roof	109.0	108	118	100/110
4	Left Front Fender	102.2	100	110	97
5	Left Front Door	114.0	120	111	111
6	Center Panel Left	101.7	94	100	111
7	Left Rear Door	104.4	117	111	85
8	Left Back Panel	106.6	104	101	115
9	Right Front Fender	104.0	103	102	107
10	Right Front Door	110.3	113	106	112
11	Center Panel Right	115.1	162	92	91
12	Right Rear Door	108.3	110	104	111
13	Right Back Panel	106.0	108	106	104

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Small / (R) Front Trim - Grime - Medium	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Dent - Minimal / (R) Side Gate - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Modified - Small / (L) Side Gate - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes
With LTO plate, with warranty booklet, with spare key 1pc, with spare tire, no tools, no jack, with warning device, no seat cover, no reverse camera, with hairline scratches.