

General Information

Date & Time: 23, May, 2026 06:42

Make	Toyota	Model	Wigo
YOM	2021	Odo Meter Reading	51,971
Registration No.	NEL3923	Chassis No.	MHKA4DF5FMJ056771
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Orange		

Body / Panel Condition



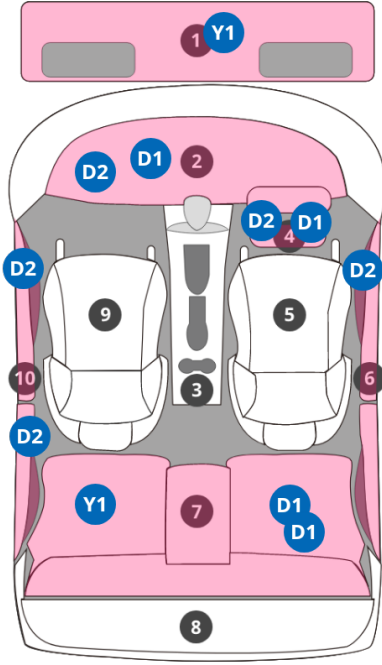
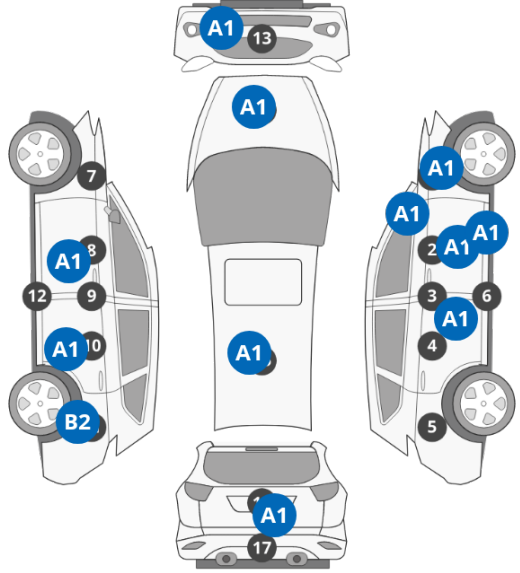
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.9	94	105	101
2	Boot Lid	114.0	100	138	104
3	Roof	86.6	86	82	91/88
4	Left Front Fender	107.0	100	110	111
5	Left Front Door	164.0	107	197	188
6	Center Panel Left				
7	Left Rear Door	157.6	149	145	179
8	Left Back Panel	152.3	137	171	149
9	Right Front Fender	103.4	110	104	96
10	Right Front Door	101.3	96	108	100
11	Center Panel Right				
12	Right Rear Door	304.3	429	336	148
13	Right Back Panel	171.0	178	174	161

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / Dashboard - Worked - Minimal / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (L) Rear Trim - Worked - Small / Rear Seat - Grime - Minimal / Trim Other - Loose, Deformed - Minimal / Seat belt Other - Loose, Deformed - Minimal / (R) Front Floor Mat - Worked - Small / Carpet - Worked - Minimal / Dashboard - Loose, Deformed - Small	Remarks (L) Rear Door - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal / (L) Rear Fender, Molding - Modified - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with Ito plate/with spare tire/no tools and jack/without manual and warranty booklet/with reverse camera/transmission unusual noise/brakes unusual noise/with hairlines scratches on the body/ac issue/no spare key