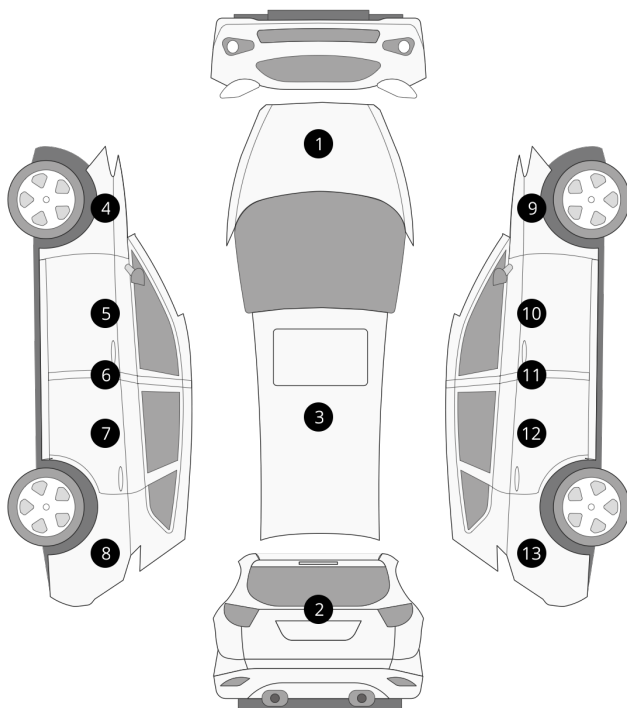


General Information

Date & Time: 22, May, 2026 16:08

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	13,067
Registration No.	DBS4583	Chassis No.	PA1B18F33R4277984
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



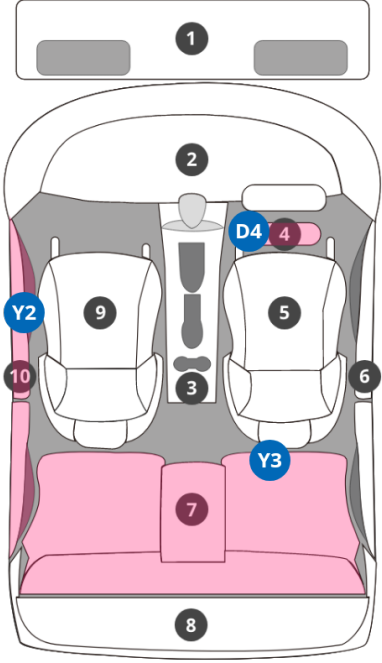
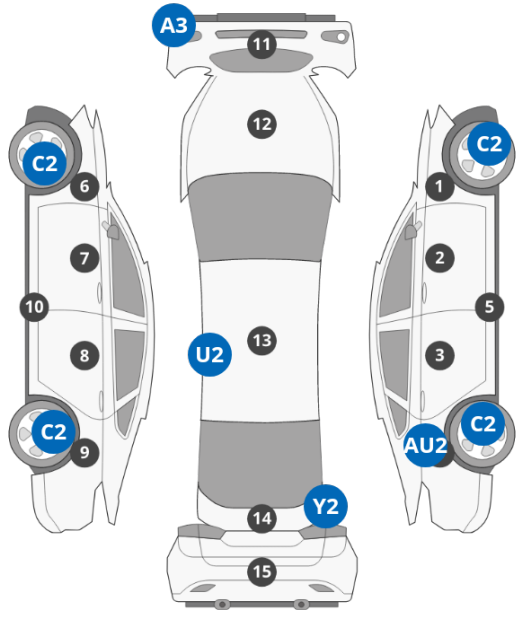
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.0	115	109	124
2	Boot Lid	120.3	117	124	120
3	Roof	113.0	125	100	116/111
4	Left Front Fender	104.6	107	100	107
5	Left Front Door	113.0	115	113	111
6	Center Panel Left				
7	Left Rear Door	117.3	116	116	120
8	Left Back Panel	116.3	115	116	118
9	Right Front Fender	105.0	106	104	105
10	Right Front Door	111.3	111	114	109
11	Center Panel Right				
12	Right Rear Door	107.3	107	107	108
13	Right Back Panel	119.6	119	110	130

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / Carpet - Worked - Large / (L) Front Trim - Grime - Small	Remarks (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Crack, Gap - Small / (L) Rear Wheel, Cover - Scratch, Corrosion - Small / (L) Front Wheel, Cover - Scratch, Corrosion - Small / (R) Rear Wheel, Cover - Scratch, Corrosion - Small / (R) Front Wheel, Cover - Scratch, Corrosion - Small / Roof - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
no tools and spare tire/ with jack and LTO plate/ with warranty booklet/ 2 keys