

General Information

Date & Time: 25, May, 2026 17:14

Make	Toyota	Model	Vios
YOM	2026	Odo Meter Reading	10,710
Registration No.	CCQ7369	Chassis No.	PA1B18F34S4302722
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



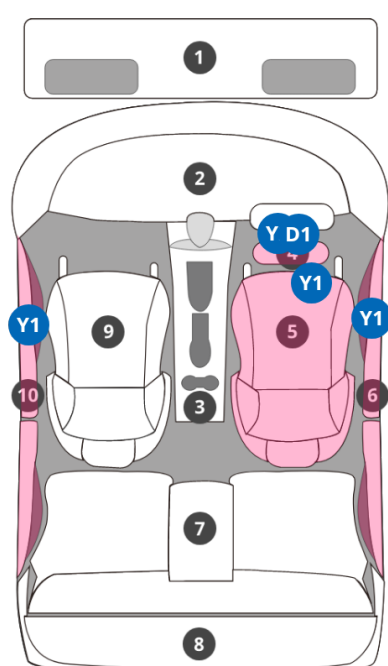
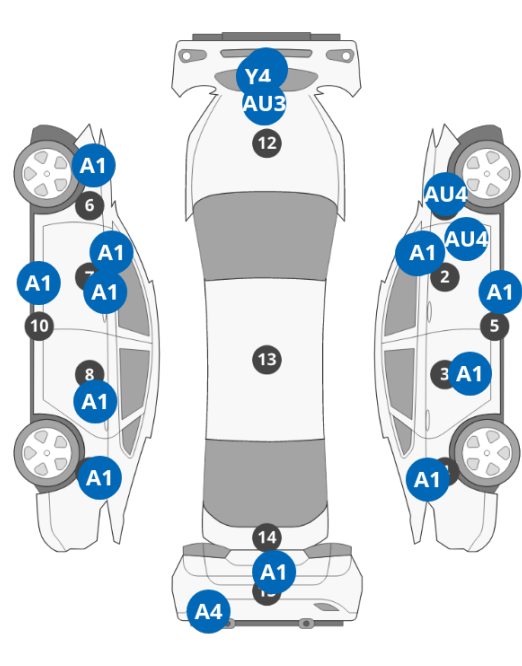
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.3	132	111	118
2	Boot Lid	127.6	119	121	143
3	Roof	111.2	109	112	104/120
4	Left Front Fender	108.3	108	109	108
5	Left Front Door	107.6	110	106	107
6	Center Panel Left				
7	Left Rear Door	110.6	113	108	111
8	Left Back Panel	121.0	126	120	117
9	Right Front Fender	119.0	120	115	122
10	Right Front Door	121.3	121	116	127
11	Center Panel Right				
12	Right Rear Door	117.0	106	118	127
13	Right Back Panel	112.3	107	113	117

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Floor Mat - Grime - Small / Carpet - Worked - Minimal / (L) Front Trim - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Mirror - Crack - Damaged / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch & Dent - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

With Lto plate, with warranty booklet and jack, 1key, no spare tire and tools, scratches on headlights and taillights, r side mirror issue ,