

General Information

Date & Time: 25, May, 2026 16:43

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	29,268
Registration No.	NKU6272	Chassis No.	PAHACACA0S6427626
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



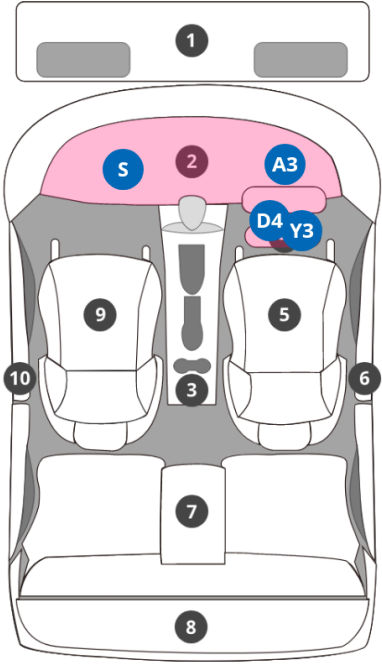
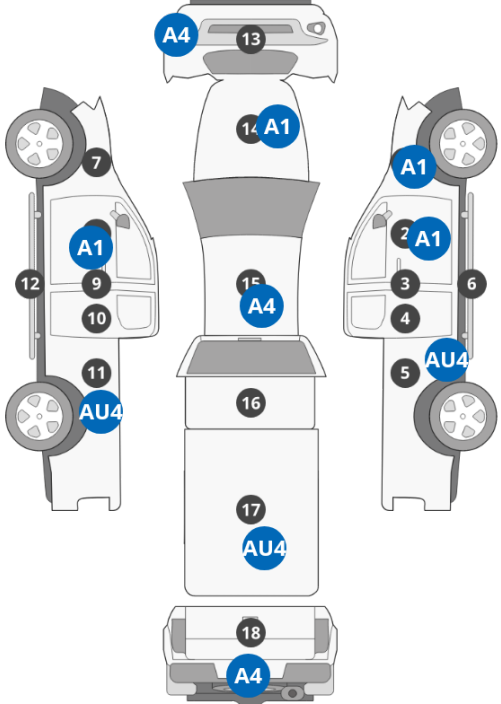
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.0	109	104	105
2	Boot Lid	56.3	56	57	56
3	Roof	90.3	106	106	70/79
4	Left Front Fender	112.6	106	101	131
5	Left Front Door	112.3	111	109	117
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	67.1	72	62	68
9	Right Front Fender	112.3	116	104	117
10	Right Front Door	116.0	119	112	117
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	62.0	53	60	73

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Worn, Scratch, Cut, Crack - Medium / (R) Front Floor Mat - Grime - Medium / (L) Front Floor Mat - Worked - Large / Overall Interior - Smell - Yes	Remarks Front Bumper, Grille, Lamps - Scratch - Large / (L) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Large / Cargo Bed Floor - Scratch & Dent - Large / (R) Side Gate - Scratch & Dent - Large / Roof - Scratch - Large / (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Parking Brake - Function - Weak

Inspector Notes
light scratches around the exterior/ possible flooding/ no jack and tools/ parking brake issue/ no LTO plate/ with spare tire and warranty booklet/