

General Information

Date & Time: 23, May, 2026 11:09

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	31,813
Registration No.	NKK4170	Chassis No.	PA1B18F3XR4269476
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



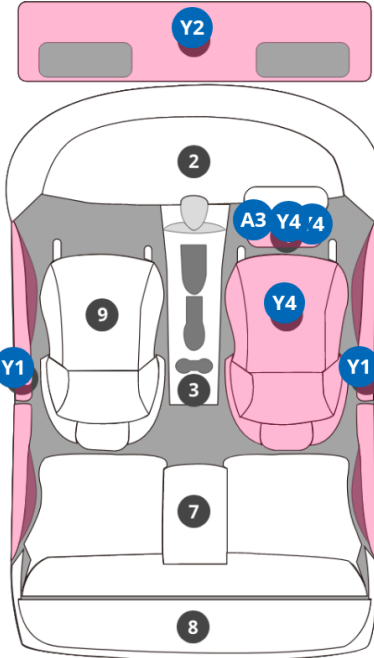
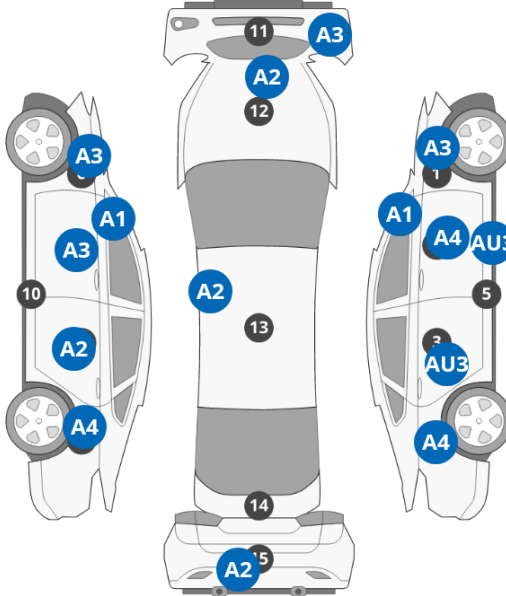
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.0	102	112	113
2	Boot Lid	115.0	112	116	117
3	Roof	99.4	107	97	97/97
4	Left Front Fender	94.9	93	100	92
5	Left Front Door	103.6	100	102	109
6	Center Panel Left				
7	Left Rear Door	110.3	115	112	104
8	Left Back Panel	119.3	126	115	117
9	Right Front Fender	94.8	97	92	96
10	Right Front Door	101.6	103	101	101
11	Center Panel Right				
12	Right Rear Door	104.1	97	102	113
13	Right Back Panel	108.6	104	105	117

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Minimal / (R) Front Floor Mat - Grime - Large / (R) Front Seat - Grime - Large / Mat Other - Grime - Large / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Cut, Crack - Medium	Remarks (L) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : D
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Power Steering - Issue - Yes / Battery - Weak - Yes

Inspector Notes

Steering issue. Battery light on. Hairline scratches and swirlmarks around the exterior. Foul smell. Without warranty booklet, spare tire and tools. With jack and seat cover. 2 keys. With LTO plate.