

General Information

Date & Time: 23, May, 2026 16:40

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	19,413
Registration No.	DBS3741	Chassis No.	MHFAA1BY7R0032262
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Red		

Body / Panel Condition



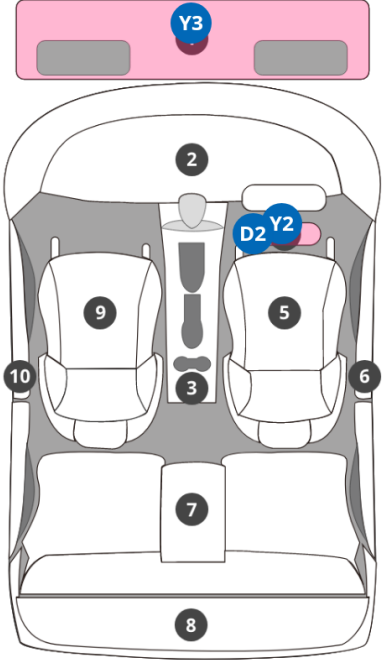
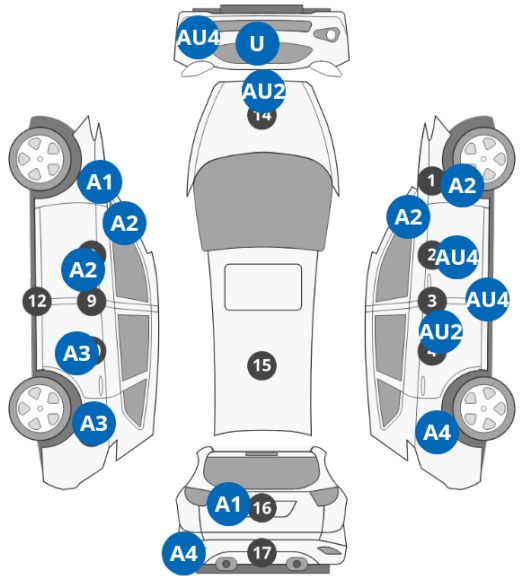
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.3	112	118	110
2	Boot Lid	109.3	107	115	106
3	Roof	119.7	133	130	109/107
4	Left Front Fender	104.6	105	102	107
5	Left Front Door	154.6	147	148	169
6	Center Panel Left				
7	Left Rear Door	184.3	173	170	210
8	Left Back Panel	166.0	224	152	122
9	Right Front Fender	106.6	107	107	106
10	Right Front Door	123.6	130	122	119
11	Center Panel Right				
12	Right Rear Door	113.3	117	111	112
13	Right Back Panel	115.0	113	110	122

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / Mat Other - Grime - Small / (L) Front Floor Mat - Worked - Small	Remarks (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

Without warranty booklet and tools. With spare tire, jack and eat cover. 1 key. With LTO plate.