

General Information

Date & Time: 25, May, 2026 17:05

Make	Toyota	Model	Avanza
YOM	2026	Odo Meter Reading	11,858
Registration No.	DCD7649	Chassis No.	MHFAA1BY1S0048365
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



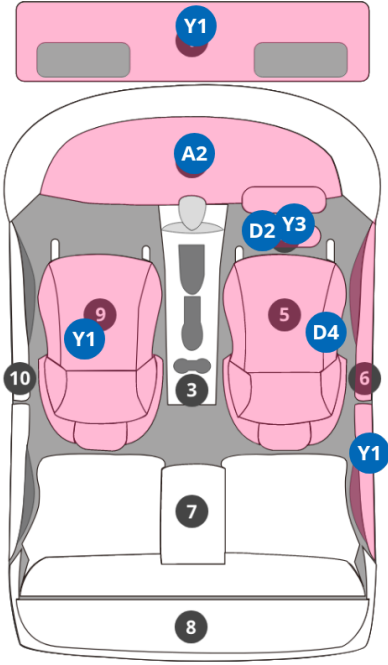
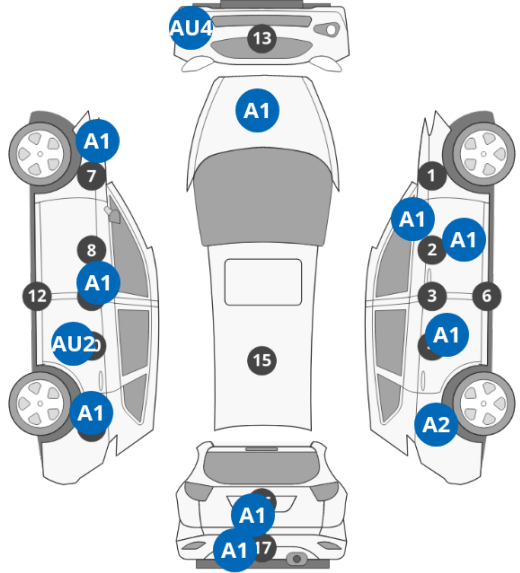
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.0	122	116	122
2	Boot Lid	122.3	123	117	127
3	Roof	118.7	130	123	113/109
4	Left Front Fender	113.6	113	107	121
5	Left Front Door	119.0	111	116	130
6	Center Panel Left				
7	Left Rear Door	120.0	124	114	122
8	Left Back Panel	127.6	141	118	124
9	Right Front Fender	108.6	111	115	100
10	Right Front Door	116.3	126	108	115
11	Center Panel Right				
12	Right Rear Door	118.0	124	107	123
13	Right Back Panel	121.6	126	114	125

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Rear Trim - Grime - Minimal / Mat Other - Grime - Medium / Ceiling - Grime - Minimal / (L) Front Seat - Grime - Minimal / (L) Front Floor Mat - Worked - Small / (R) Front Seat belt - Loose, Deformed - Large / Steering Wheel - Worn, Peel, Crack - Small	Remarks (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Power Steering - Issue - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Seat Belts - Issue - Yes

Inspector Notes
With Lto plate, with spare tire and jack, 2keys, with warranty booklet ,no tools, EPS warning lamp on, airbag warning lamp on, maintenance warning lamp on, front seats issue, steering wheel issue,