

General Information

Date & Time: 25, May, 2026 07:42

Make	Toyota	Model	Fortuner
YOM	2024	Odo Meter Reading	46,059
Registration No.	BAG5879	Chassis No.	MHFCB3GS1R0496587
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



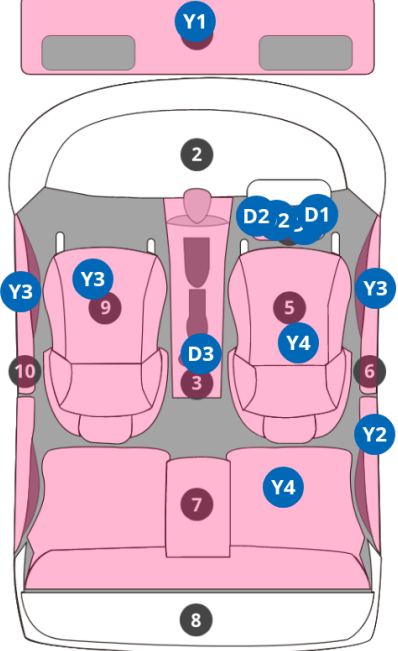
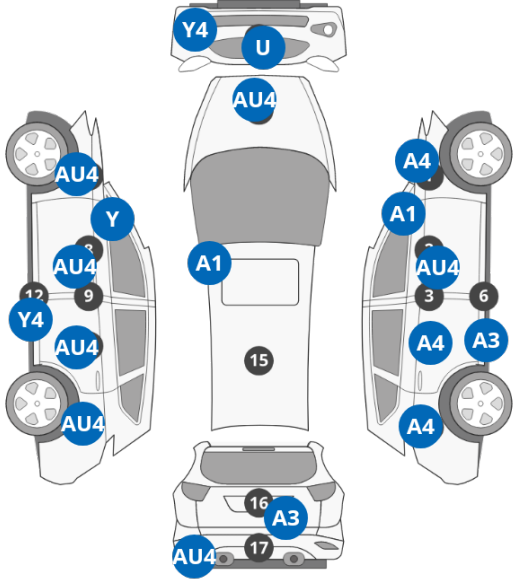
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.0	123	129	117
2	Boot Lid	115.1	111	135	100
3	Roof	122.2	121	138	109/121
4	Left Front Fender	117.0	107	120	124
5	Left Front Door	117.0	130	106	115
6	Center Panel Left				
7	Left Rear Door	113.0	121	104	114
8	Left Back Panel	120.3	125	119	117
9	Right Front Fender	124.0	121	141	110
10	Right Front Door	115.0	118	114	113
11	Center Panel Right				
12	Right Rear Door	111.3	112	103	119
13	Right Back Panel	127.3	135	118	129

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Large / Ceiling - Grime - Minimal / Mat Other - Worked - Small / (R) Rear Trim - Grime - Small / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Large / (R) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / Carpet - Worked - Minimal / Console, Switchs, Vents - Loose, Deformed - Medium	Remarks (R) Front Fender, Molding - Scratch - Large / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch & Dent - Large / Member (Bolted) - Dent - Yes / Roof Spoiler, Molding - Scratch - Minimal / (L) Mirror - Crack - Cracks / (L) Step, In-panel, Side Spoiler - Crack, Gap - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With Lto plate, with spare tire and jack, 2keys, no warranty booklet and tools, Crack headlight, scratches on taillights, Left front door gap,plate light issue