

General Information

Date & Time: 25, May, 2026 17:40

Make	Toyota	Model	Hilux Tamaraw
YOM	2026	Odo Meter Reading	18,947
Registration No.	NJG1614	Chassis No.	PAHACACA7S6439779
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



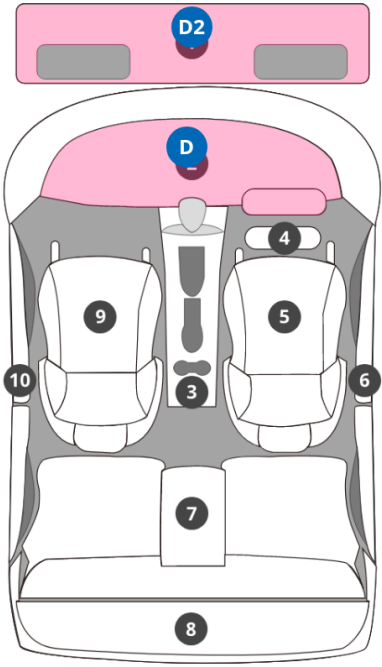
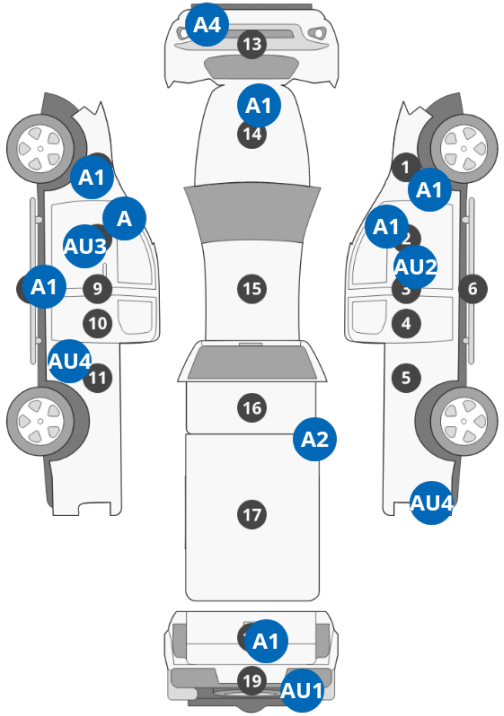
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.3	112	122	100
2	Boot Lid	71.8	68	66	81
3	Roof	125.2	136	126	126/113
4	Left Front Fender	121.0	113	123	127
5	Left Front Door	112.3	114	112	111
6	Center Panel Left	104.5	123	101	90
7	Left Rear Door				
8	Left Back Panel	81.0	70	97	76
9	Right Front Fender	108.0	114	108	102
10	Right Front Door	109.3	103	114	111
11	Center Panel Right	106.6	114	101	105
12	Right Rear Door				
13	Right Back Panel	88.3	86	95	85

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Loose, Deformed - Small / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Minimal / Rear Gate - Scratch - Minimal / (L) Side Gate - Scratch & Dent - Large / Roof - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Mirror - Scratch, Peeled - Yes / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

With Lto plate, with warranty booklet, with spare tire and jack, 1key, no tools, rear door no key,