

General Information

Date & Time: 25, May, 2026 17:50

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	4,210
Registration No.	NKT2143	Chassis No.	PA1B18F38S4293412
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



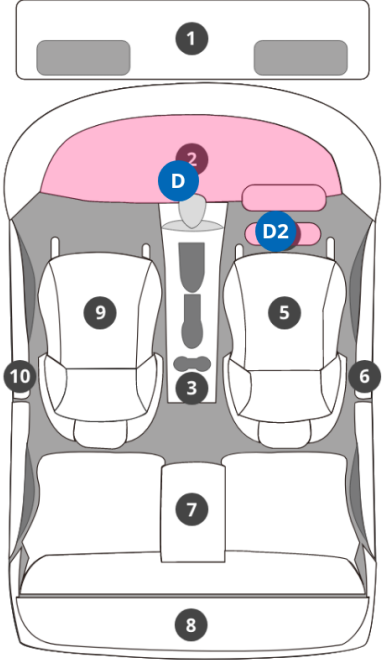
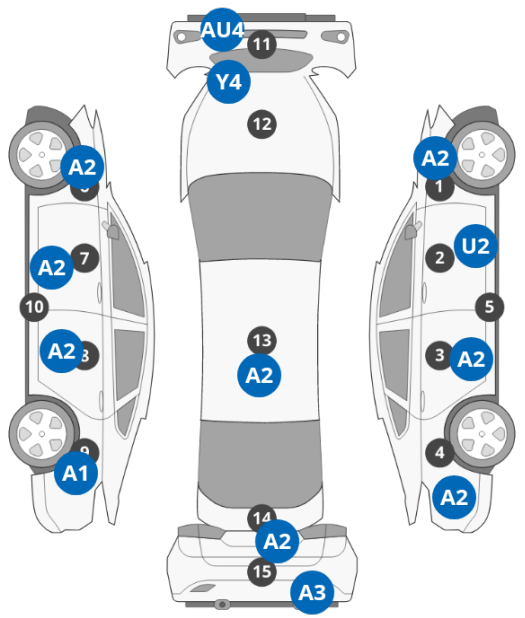
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.0	121	112	118
2	Boot Lid	122.3	122	122	123
3	Roof	109.7	119	105	108/107
4	Left Front Fender	101.3	100	102	102
5	Left Front Door	115.6	119	109	119
6	Center Panel Left				
7	Left Rear Door	115.0	121	114	110
8	Left Back Panel	117.6	119	123	111
9	Right Front Fender	107.6	110	111	102
10	Right Front Door	111.0	115	107	111
11	Center Panel Right				
12	Right Rear Door	109.3	112	108	108
13	Right Back Panel	123.3	114	120	136

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Worked - Small	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Crack, Gap - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (R) Front Door, Molding - Dent - Small / Roof - Scratch - Small
Frame Evaluation : B	Functional Evaluation : D
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Head Light, High Beam - Issue - Yes

Inspector Notes
air-conditioning issue/ ABS warning light on/ traction control light on/ airbag warning light on/ with spare tire and jack/ with LTO plate and warranty booklet/ light scratches around the exterior/ 3 keys