

General Information

Date & Time: 23, May, 2026 17:52

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	23,695
Registration No.	CCG7751	Chassis No.	PA1B18F3XR4278596
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



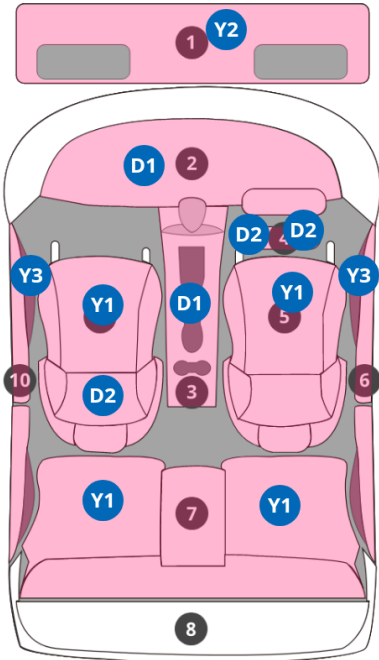
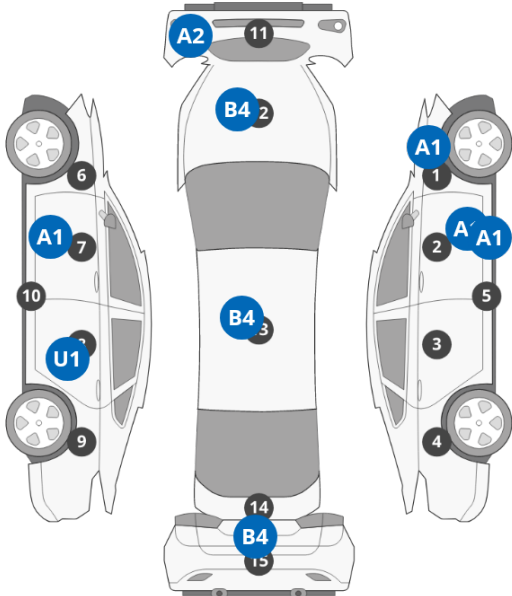
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	224.3	224	229	220
2	Boot Lid	241.0	234	256	233
3	Roof	214.0	206	213	216/221
4	Left Front Fender	106.6	108	106	106
5	Left Front Door	104.6	109	104	101
6	Center Panel Left				
7	Left Rear Door	113.0	124	110	105
8	Left Back Panel	114.6	119	113	112
9	Right Front Fender	122.6	106	141	121
10	Right Front Door	117.0	118	116	117
11	Center Panel Right				
12	Right Rear Door	116.0	110	118	120
13	Right Back Panel	117.0	112	116	123

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Medium / Rear Seat - Grime - Minimal / Trim Other - Grime - Minimal / (L) Front Seat Head Rest - Worked - Small / Console, Switches, Vents - Worked - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / Dashboard - Worked - Minimal / Ceiling - Grime - Small / (R) Front Trim - Grime - Medium	Remarks Bonnet - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Trunk Hood, Rear Gate - Modified - Large / (L) Rear Door, Molding - Dent - Minimal / (L) Front Door, Molding - Scratch - Minimal / Roof - Modified - Large / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Modified - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

with Ito plate/with tools no jack/without spare tire/with reverse camera/modified rear trunk,roof,hood/with hairlines scratches on the body/no spare key