

General Information

Date & Time: 26, May, 2026 08:29

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	11,818
Registration No.	GBB3366	Chassis No.	MHKAA1BC0SJ037695
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Orange		

Body / Panel Condition



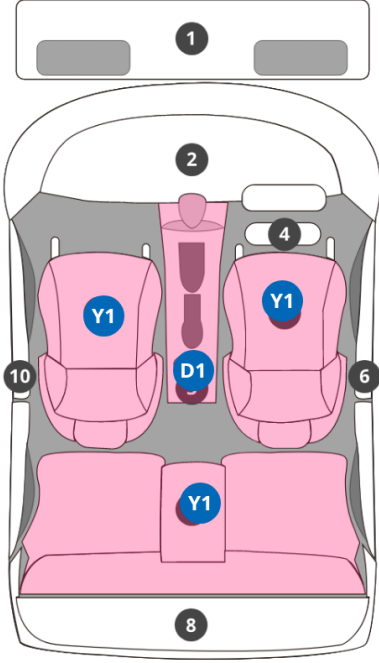
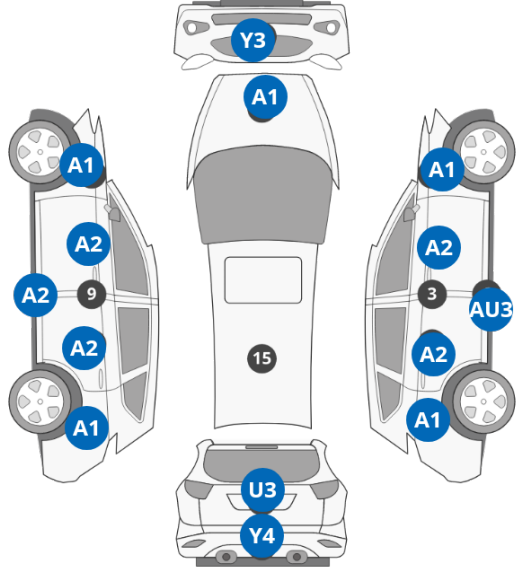
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	127.6	128	131	124
2	Boot Lid	72.8	11	106	102
3	Roof	116.5	117	114	114/121
4	Left Front Fender	121.0	151	106	106
5	Left Front Door	113.0	111	110	118
6	Center Panel Left				
7	Left Rear Door	110.0	111	108	111
8	Left Back Panel	93.2	71	105	104
9	Right Front Fender	99.5	97	102	100
10	Right Front Door	115.3	119	111	116
11	Center Panel Right				
12	Right Rear Door	145.3	129	159	148
13	Right Back Panel	104.0	107	100	105

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / Console, Switchs, Vents - Loose, Deformed - Minimal	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Minimal / Trunk Hood, Rear Gate - Dent - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

With LTO plate, with warranty booklet, with spare tire, with spare key 1pc, with hairline scratches, no tools, no jack, no seat cover.