

General Information

Date & Time: 26, May, 2026 04:54

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	23,081
Registration No.	JAS7778	Chassis No.	PA1B18F34R4246422
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



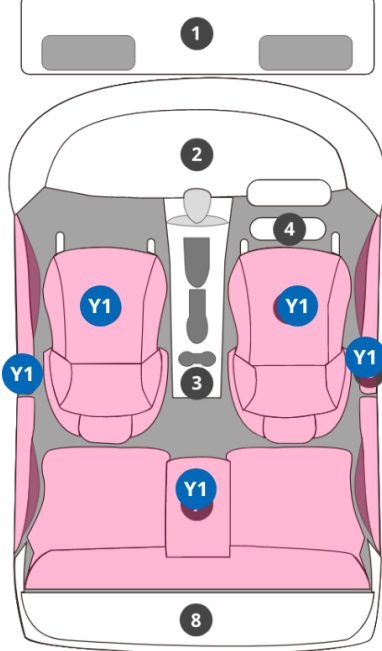
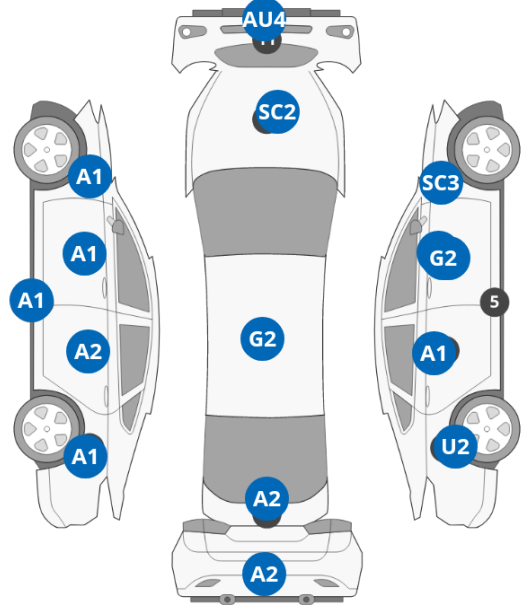
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.3	117	116	116
2	Boot Lid	115.6	116	113	118
3	Roof	119.5	118	130	109/121
4	Left Front Fender	104.0	109	102	101
5	Left Front Door	102.5	104	99	105
6	Center Panel Left				
7	Left Rear Door	117.3	121	121	110
8	Left Back Panel	121.6	127	117	121
9	Right Front Fender	111.3	113	110	111
10	Right Front Door	114.3	113	111	119
11	Center Panel Right				
12	Right Rear Door	123.0	114	131	124
13	Right Back Panel	116.3	115	113	121

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Minimal	Remarks (R) Front Fender, Molding - Rust, Corrosion - Medium / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Rust, Corrosion - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Side Window - Scratch, Stone chip - Small / Rear Windshield - Scratch, Stone chip - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With LTO plate, with warranty booklet, with tools, with jack, with spare tire, with spare key 1pc, with hairline scratches, no seat cover.