

General Information

Date & Time: 26, May, 2026 04:55

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	37,332
Registration No.	KAU4225	Chassis No.	MHKAA1BC1RJ032709
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



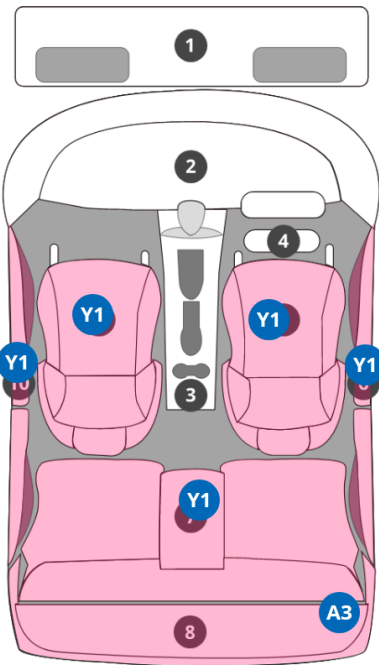
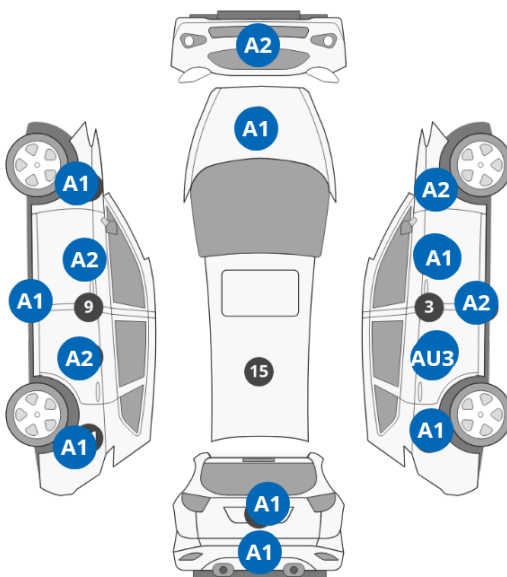
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	137.3	147	133	132
2	Boot Lid	93.5	97	95	89
3	Roof	93.8	92	86	98/100
4	Left Front Fender	99.1	92	108	97
5	Left Front Door	111.0	110	107	116
6	Center Panel Left				
7	Left Rear Door	106.2	113	106	100
8	Left Back Panel	111.4	109	95	130
9	Right Front Fender	91.6	90	98	87
10	Right Front Door	115.0	118	112	115
11	Center Panel Right				
12	Right Rear Door	109.2	95	106	127
13	Right Back Panel	101.8	97	117	92

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B		Exterior Evaluation : C	
			
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Trunk Room - Worn, Scratch, Cut, Crack - Medium		Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Side Window - Scratch, Stone chip - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal	
Frame Evaluation : A		Functional Evaluation : A	
Remarks Defects not found		Remarks Defects not found	

Inspector Notes

With LTO plate, no warranty booklet, with spare key 1pc, with spare tire, incomplete tools, with jack, no seat cover, with hairline scratches.