

General Information

Date & Time: 25, May, 2026 15:13

Make	Toyota	Model	Vios
YOM	2018	Odo Meter Reading	31,714
Registration No.	A8E625	Chassis No.	PA1B23F38J6005424
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



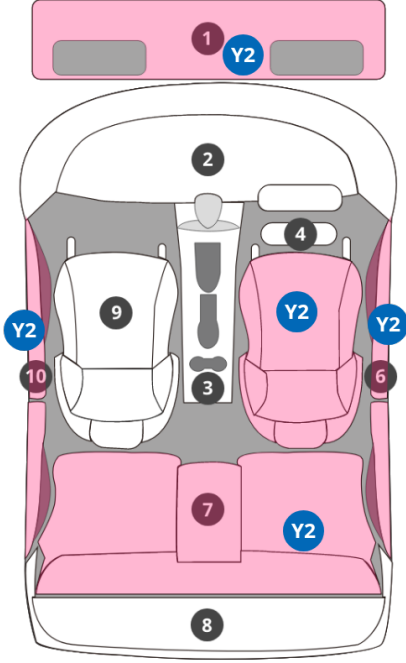
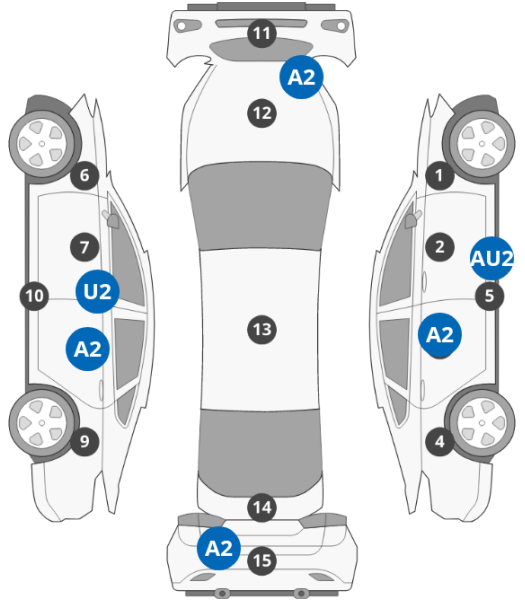
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.3	116	111	113
2	Boot Lid	138.6	137	164	115
3	Roof	115.9	125	97	108/134
4	Left Front Fender	102.5	100	101	107
5	Left Front Door	110.0	107	114	109
6	Center Panel Left				
7	Left Rear Door	104.0	106	100	106
8	Left Back Panel	117.3	118	117	117
9	Right Front Fender	109.0	118	107	102
10	Right Front Door	107.3	108	113	101
11	Center Panel Right				
12	Right Rear Door	107.3	105	104	113
13	Right Back Panel	116.0	115	112	121

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Small	Remarks Bonnet - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Front Door, Molding - Dent - Small / (L) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes / Seat Belts - Issue - Yes

Inspector Notes
NO LTO PLATE. Non moving unit. shift gear stuck to neutral. check engine. Maintenance lamp on. Change to push button start. With spare tire. 2 remote key not original. With jack and tools. No warranty booklet. with seat cover