

General Information

Date & Time: 26, May, 2026 18:34

Make	Toyota	Model	Hiace
YOM	2018	Odo Meter Reading	137,613
Registration No.	NBP1428	Chassis No.	JTFRT13P4J8029458
CC	3.0	Transmission	A/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



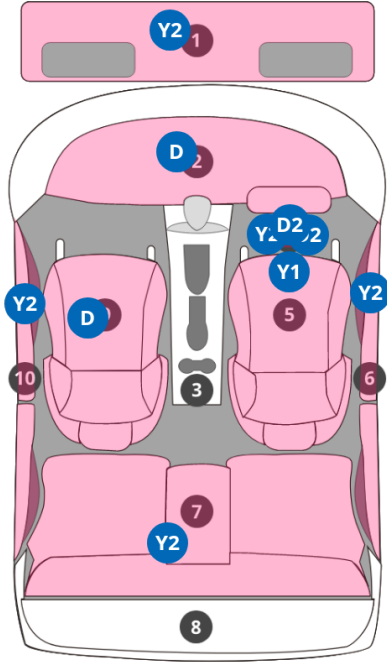
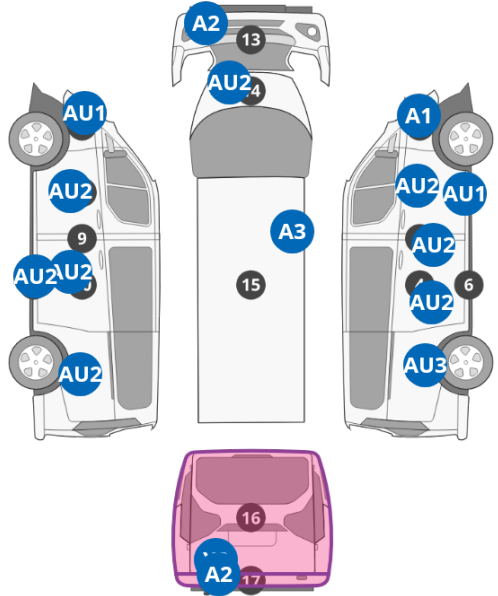
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.6	120	122	126
2	Boot Lid	200.0	239	215	146
3	Roof	128.0	112	110	151/139
4	Left Front Fender	126.0	125	127	126
5	Left Front Door	131.6	126	137	132
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	134.3	134	128	141
9	Right Front Fender	136.6	136	137	137
10	Right Front Door	127.6	129	133	121
11	Center Panel Right	140.6	155	132	135
12	Right Rear Door	140.6	139	145	138
13	Right Back Panel	153.6	138	143	180

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Minimal / (L) Front Seat - Worn - Yes / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Grime - Small / (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Crinkle - Small / Mat Other - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Scratch - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Center Panel - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Repair mark - Yes / Trunk Hood, Rear Gate - Crack, Gap - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Panel - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

with LTO plate, with spare tire, with reverse camera, with warranty and manual booklet, no tools and jack, issue on retractable mirror right side, scratches and dent on exterior, scratches on taillight and headlight, aircon freon issue.