

General Information

Date & Time: 26, May, 2026 18:35

Make	Toyota	Model	Innova
YOM	2015	Odo Meter Reading	152,082
Registration No.	APA7081	Chassis No.	KUN405117777
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



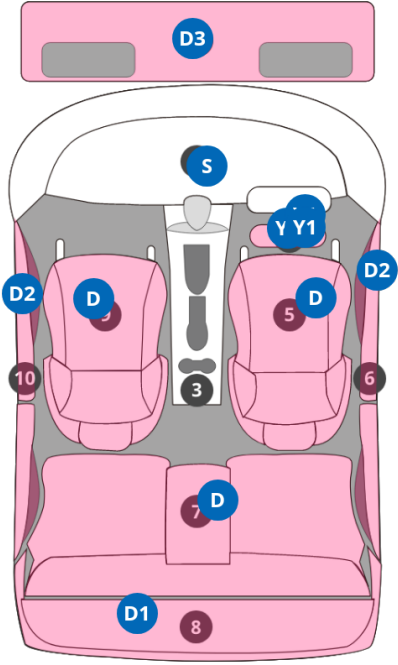
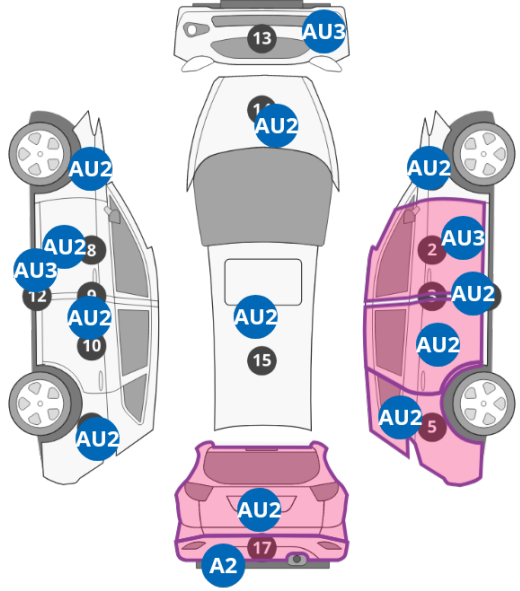
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	124.6	115	134	125
2	Boot Lid	184.6	190	185	179
3	Roof	118.0	123	111	113/125
4	Left Front Fender	118.6	114	124	118
5	Left Front Door	118.6	121	127	108
6	Center Panel Left				
7	Left Rear Door	138.6	116	127	173
8	Left Back Panel	121.6	116	136	113
9	Right Front Fender	170.3	180	160	171
10	Right Front Door	175.0	213	160	152
11	Center Panel Right				
12	Right Rear Door	204.0	172	207	233
13	Right Back Panel	254.0	213	185	364

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Worn - Yes / (L) Front Seat - Worn - Yes / Rear Seat - Worn - Yes / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (R) Front Floor Mat - Grime - Minimal / (L) Front Floor Mat - Grime - Minimal / Mat Other - Grime - Minimal / Ceiling - Crinkle - Medium / Trunk Room - Worked - Minimal / Overall Interior - Smell - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Step - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small / Overall Exterior - Full Re-Paint in same color - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small
Frame Evaluation : D	Functional Evaluation : A
Remarks Right Center Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate, with spare tire, no warranty and manual booklet, no jack and tools, no reverse camera, no spare key, scratches and dent on exterior, scratches on taillight and headlight, crack issue on taillight.