

## General Information

Date & Time: 26, May, 2026 18:20

|                  |         |                   |                   |
|------------------|---------|-------------------|-------------------|
| Make             | Toyota  | Model             | Wigo              |
| YOM              | 2023    | Odo Meter Reading | 41,500            |
| Registration No. | CBE8399 | Chassis No.       | MHKA4DF5FNJ075572 |
| CC               | 1.0     | Transmission      | A/T               |
| Fuel Type        | Gas     | Type of Body      | Hatchback         |
| Colour           | Gray    |                   |                   |

## Body / Panel Condition



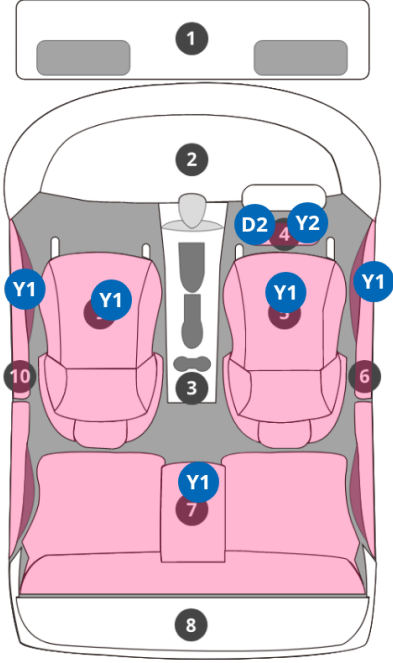
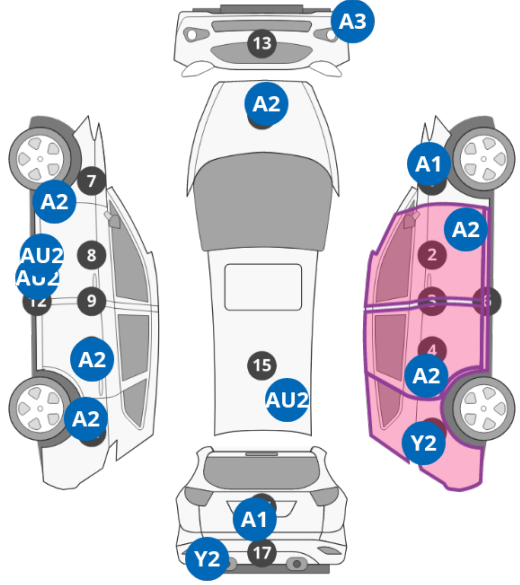
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 112.6         | 113    | 117    | 108      |
| 2  | Boot Lid           | 107.3         | 107    | 106    | 109      |
| 3  | Roof               | 96.9          | 90     | 91     | 108/99   |
| 4  | Left Front Fender  | 95.9          | 88     | 106    | 94       |
| 5  | Left Front Door    | 92.2          | 92     | 93     | 91       |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 89.7          | 86     | 89     | 94       |
| 8  | Left Back Panel    | 100.1         | 100    | 106    | 95       |
| 9  | Right Front Fender | 100.9         | 94     | 89     | 120      |
| 10 | Right Front Door   | 163.3         | 151    | 159    | 180      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 174.6         | 218    | 157    | 149      |
| 13 | Right Back Panel   | 528.0         | 139    | 193    | 1,252    |

## Overall Evaluation :

C

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| Interior Evaluation : <span style="color: red; font-weight: bold;">A</span>                                                                                                                                                                                            | Exterior Evaluation : <span style="color: red; font-weight: bold;">D</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>                     |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |
| <b>Remarks</b><br>(R) Front Trim - Grime - Minimal / (R) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Rear Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal | <b>Remarks</b><br>(R) Step - Repair Traces - Yes / (R) Step - Replaced - Yes / (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Replaced - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Fender, Molding - Crack, Gap - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Roof - Scratch & Dent - Small |
| Frame Evaluation : <span style="color: red; font-weight: bold;">D</span>                                                                                                                                                                                               | Functional Evaluation : <span style="color: red; font-weight: bold;">B</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |
| <b>Remarks</b><br>Right Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes / Rear Side Member & Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes                                                                           | <b>Remarks</b><br>Battery - Weak - Yes / Spare Key - Issue - Unexist                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |

| Inspector Notes                                                                                                                     |
|-------------------------------------------------------------------------------------------------------------------------------------|
| with LTO plate/no warranty booklet/with incomplete tools with jack/with spare tire/hairline scratches on the body/plate light issue |