

General Information

Date & Time: 26, May, 2026 18:15

Make	Toyota	Model	Wigo
YOM	2021	Odo Meter Reading	45,930
Registration No.	NEV3727	Chassis No.	MHKA4DF5FMJ059592
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



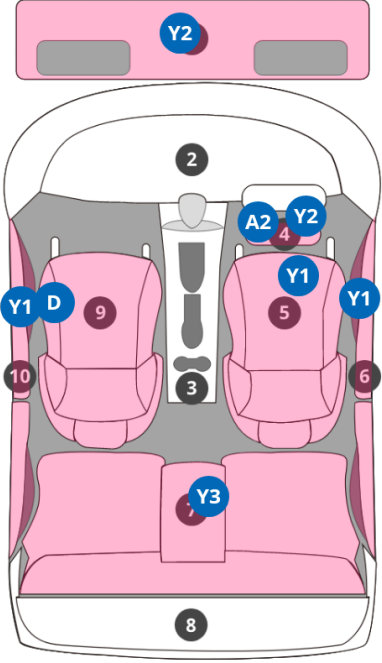
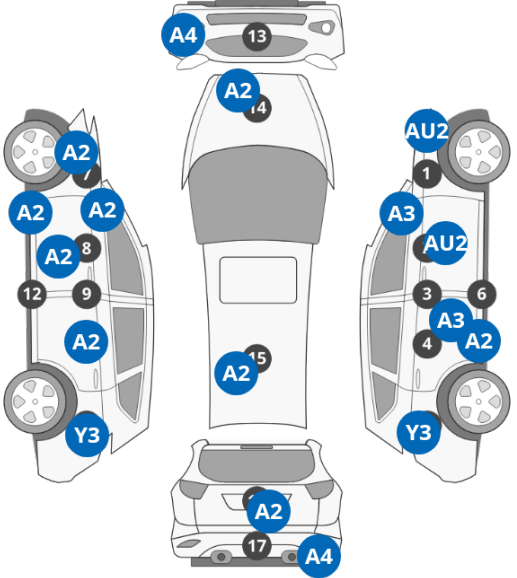
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.3	107	101	108
2	Boot Lid	101.6	99	105	101
3	Roof	88.9	85	93	89/90
4	Left Front Fender	90.6	89	95	88
5	Left Front Door	89.5	88	93	88
6	Center Panel Left				
7	Left Rear Door	90.5	87	96	89
8	Left Back Panel	91.8	92	96	88
9	Right Front Fender	92.3	88	101	89
10	Right Front Door	89.0	86	95	86
11	Center Panel Right				
12	Right Rear Door	81.3	83	79	82
13	Right Back Panel	91.3	88	93	93

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Minimal / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Cut, Crack - Small / (L) Front Seat - Worn - Yes / Ceiling - Grime - Small / (L) Front Trim - Grime - Minimal	Remarks (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / (L) Mirror - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Crack, Gap - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Crack, Gap - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/no warranty booklet/with incomplete tools with jack/with spare tire/passenger grab bar issue/scratches on headlight cover/hairline scratches on the body