

General Information

Date & Time: 26, May, 2026 18:17

Make	Toyota	Model	Hiace
YOM	2024	Odo Meter Reading	26,942
Registration No.	NFR3160	Chassis No.	JTFNAFAP5P8040224
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



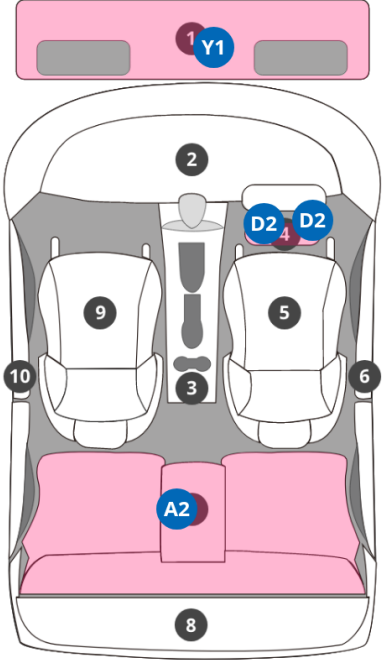
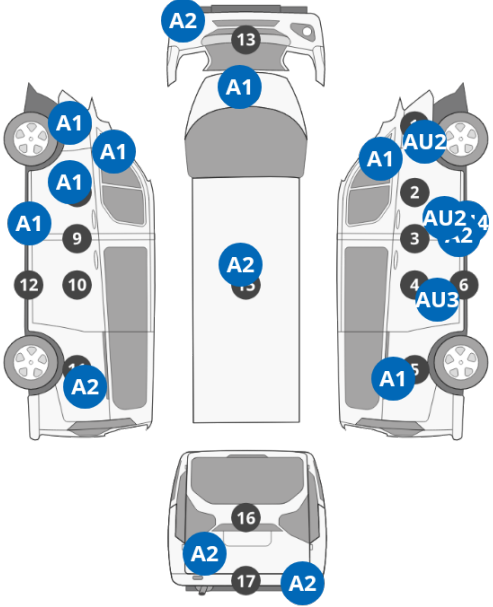
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	131.6	133	126	136
2	Boot Lid	100.8	99	98	105
3	Roof	109.7	109	115	110/105
4	Left Front Fender	120.3	115	121	125
5	Left Front Door	138.3	149	138	128
6	Center Panel Left	111.5	117	120	98
7	Left Rear Door				
8	Left Back Panel	97.6	102	96	96
9	Right Front Fender	96.8	100	101	90
10	Right Front Door	99.3	100	101	97
11	Center Panel Right	115.6	126	113	108
12	Right Rear Door	102.7	99	103	106
13	Right Back Panel	103.3	97	102	111

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal / Rear Seat - Cut, Crack - Small	Remarks Bonnet - Repair Traces - Yes / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Center Panel - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/no warranty booklet/no tools with jack/with spare tire/hairline scratches on the body/crack on taillight cover