

General Information

Date & Time: 26, May, 2026 13:33

Make	Toyota	Model	Vios
YOM	2020	Odo Meter Reading	37,309
Registration No.	NGD6677	Chassis No.	PA1B18F34L4109777
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



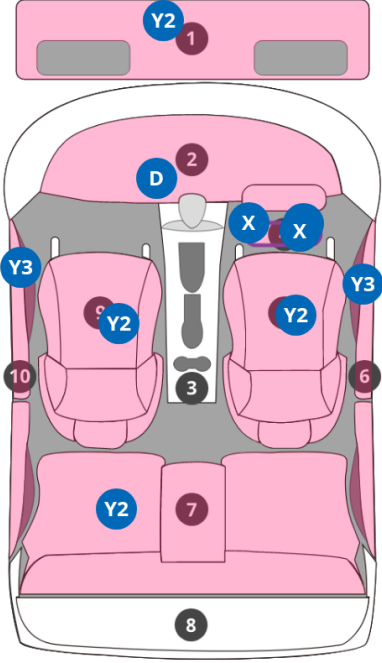
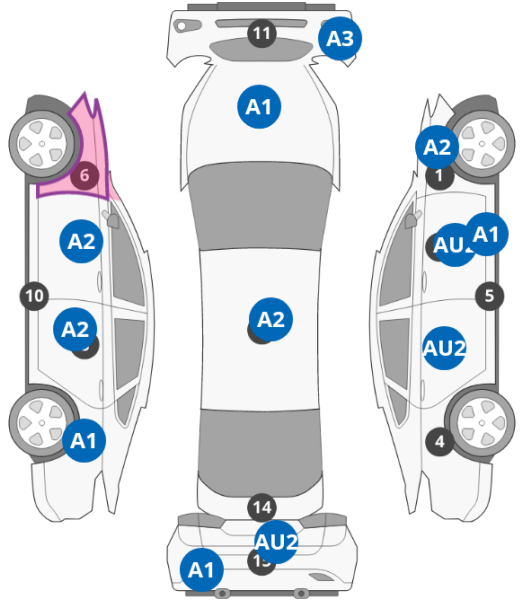
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.0	109	112	106
2	Boot Lid	131.0	124	134	135
3	Roof	101.0	111	95	96/102
4	Left Front Fender	543.0	202	1,230	197
5	Left Front Door	112.3	123	106	108
6	Center Panel Left				
7	Left Rear Door	106.6	109	107	104
8	Left Back Panel	113.0	118	107	114
9	Right Front Fender	109.3	112	108	108
10	Right Front Door	142.3	145	143	139
11	Center Panel Right				
12	Right Rear Door	111.3	103	112	119
13	Right Back Panel	114.0	109	104	129

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Medium / Ceiling - Grime - Small / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Small	Remarks (R) Step - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Fender, Molding - Repair mark - Difference in Color / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small
Frame Evaluation : B	Functional Evaluation : A
Remarks Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes	Remarks Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with Ito plate/warranty booklet/with tools no jack/with hairlines scratches on the body/with spare tire/no reverse camera/no spare key.