

General Information

Date & Time: 26, May, 2026 13:45

Make	Toyota	Model	Lite Ace
YOM	2024	Odo Meter Reading	43,849
Registration No.	NHS5591	Chassis No.	MHKU3FE10RK006876
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Dropside
Colour	White		

Body / Panel Condition



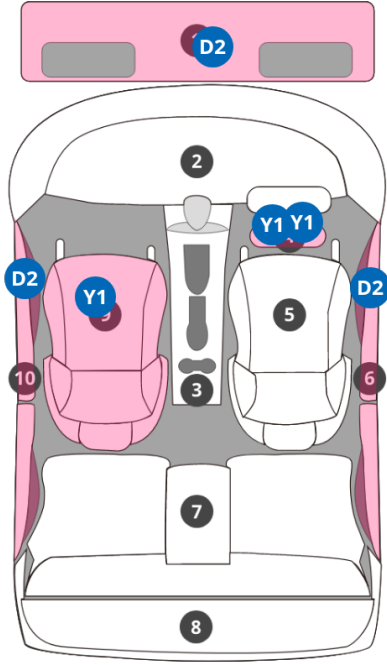
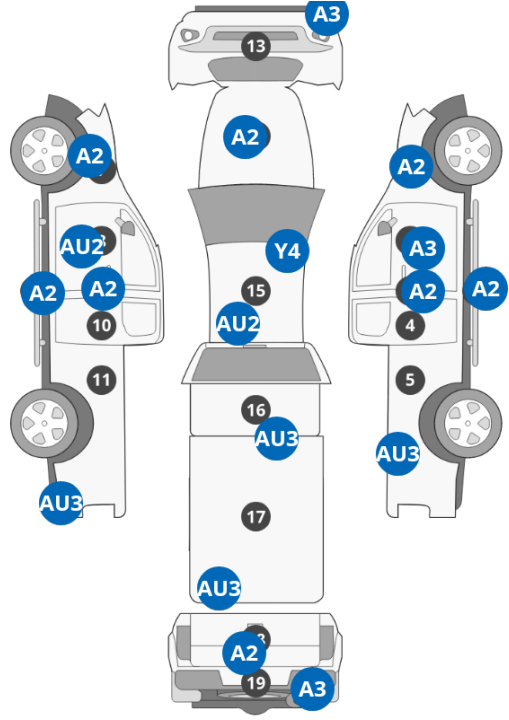
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.7	101	93	111
2	Boot Lid	93.0	99	88	93
3	Roof	102.9	127	100	93/92
4	Left Front Fender	94.1	94	91	97
5	Left Front Door	94.6	92	91	101
6	Center Panel Left				
7	Left Rear Door	98.1	94	99	101
8	Left Back Panel	98.1	86	93	115
9	Right Front Fender	90.9	87	91	95
10	Right Front Door	89.3	89	93	86
11	Center Panel Right	94.3	94	92	97
12	Right Rear Door				
13	Right Back Panel	88.8	90	88	88

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Minimal / (L) Front Floor Mat - Grime - Minimal / (R) Front Floor Mat - Grime - Minimal / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Ceiling - Crinkle - Small	Remarks (L) Front Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Front Panel - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Front Windshield - Damaged - Large / Roof - Scratch & Dent - Small / Cab Back Panel - Scratch & Dent - Medium / Cargo Bed Floor - Scratch & Dent - Medium / Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Side Gate - Scratch & Dent - Medium / (L) Side Gate - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Center Panel - Scratch - Small / (R) Center Panel - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate, with spare tire, with warranty booklet, no tools and jack, no manual booklet, no reverse camera, scratches on taillight and headlight, issue on windshield, scratches and dent on exterior.