

## General Information

Date & Time: 26, May, 2026 18:23

|                  |         |                   |                   |
|------------------|---------|-------------------|-------------------|
| Make             | Toyota  | Model             | Vios              |
| YOM              | 2022    | Odo Meter Reading | 84,694            |
| Registration No. | NFJ6543 | Chassis No.       | PA1B18F3XN4173308 |
| CC               | 1.3     | Transmission      | M/T               |
| Fuel Type        | Gas     | Type of Body      | Sedan             |
| Colour           | Blue    |                   |                   |

## Body / Panel Condition



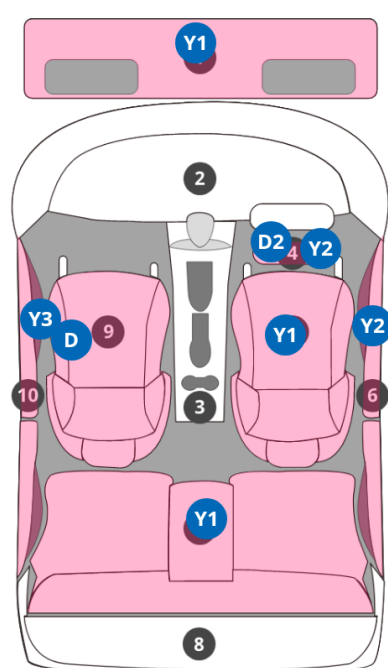
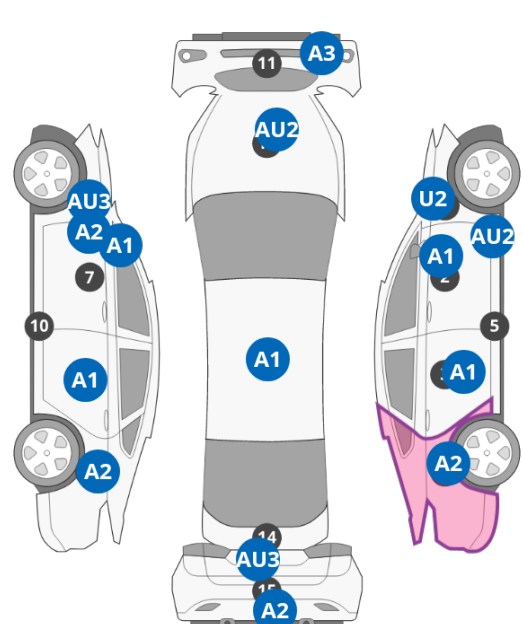
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 110.6         | 107    | 111    | 114      |
| 2  | Boot Lid           | 101.2         | 94     | 101    | 109      |
| 3  | Roof               | 92.8          | 100    | 89     | 88/94    |
| 4  | Left Front Fender  | 100.3         | 98     | 103    | 100      |
| 5  | Left Front Door    | 101.4         | 98     | 104    | 102      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 99.2          | 97     | 103    | 98       |
| 8  | Left Back Panel    | 112.3         | 120    | 114    | 103      |
| 9  | Right Front Fender | 102.6         | 105    | 100    | 103      |
| 10 | Right Front Door   | 104.3         | 108    | 105    | 100      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 115.0         | 125    | 107    | 113      |
| 13 | Right Back Panel   | 639.0         | 301    | 1,155  | 461      |

## Overall Evaluation :

C

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

|                                                                                                                                                                                                                                                                                                                     |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <div> <div>Interior Evaluation :</div> <div>B</div> </div>                                                                                                                                                                                                                                                          | <div> <div>Exterior Evaluation :</div> <div>D</div> </div>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |
| <div>  </div> <div> <div>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</div> </div>                                                                                     | <div>  </div> <div> <div>A : Scratch AU : Scratch &amp; Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust &amp; Corrosion U : Dent X : Defective Y : Crack, Gap</div> </div>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |
| <div> <div>Remarks</div> <div>(R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Ceiling - Grime - Minimal</div> </div> | <div> <div>Remarks</div> <div>(R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch &amp; Dent - Medium / Bonnet, Headlight - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch - Minimal</div> </div> |
| <div> <div>Frame Evaluation :</div> <div>A</div> </div>                                                                                                                                                                                                                                                             | <div> <div>Functional Evaluation :</div> <div>B</div> </div>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |
| <div> <div>Remarks</div> <div>Defects not found</div> </div>                                                                                                                                                                                                                                                        | <div> <div>Remarks</div> <div>Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</div> </div>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |

## Inspector Notes

with LTO plate/no warranty booklet/with incomplete tools with jack/with spare tire/reverse light issue/key issue/ hairline scratches on the body/no reverse camera/with seat cover