

General Information

Date & Time: 26, May, 2026 18:28

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	26,897
Registration No.	NIJ9354	Chassis No.	PA1B18F31P4204514
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



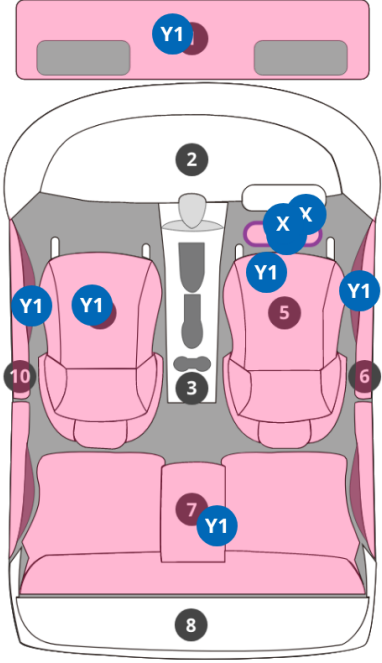
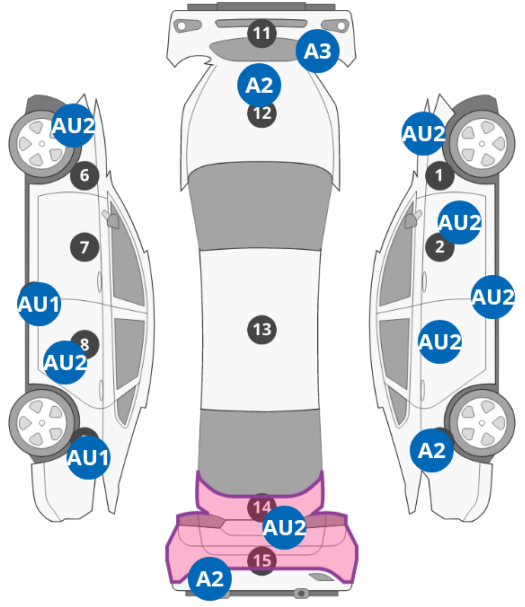
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	110	100	116
2	Boot Lid	166.6	187	195	118
3	Roof	101.8	100	102	94/111
4	Left Front Fender	105.6	107	104	106
5	Left Front Door	109.3	113	108	107
6	Center Panel Left				
7	Left Rear Door	109.3	110	111	107
8	Left Back Panel	113.6	115	114	112
9	Right Front Fender	108.6	115	108	103
10	Right Front Door	113.0	115	107	117
11	Center Panel Right				
12	Right Rear Door	109.0	103	110	114
13	Right Back Panel	108.6	104	110	112

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Ceiling - Grime - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / Roof - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with spare tire, with jack and inc tools, with manual and warranty booklet, no reverse camera, no spare key, scratches on exterior, scratches on taillight and headlight.