

General Information

Date & Time: 05, Jun, 2026 14:32

Make	Toyota	Model	Vios
YOM	2020	Odo Meter Reading	65,061
Registration No.	NGN8465	Chassis No.	PA1B1F39L4118801
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



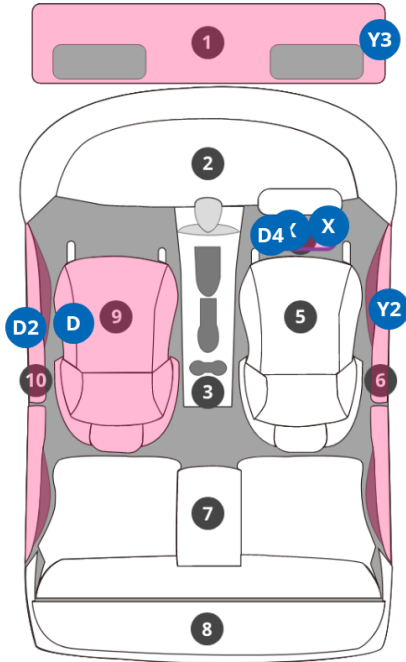
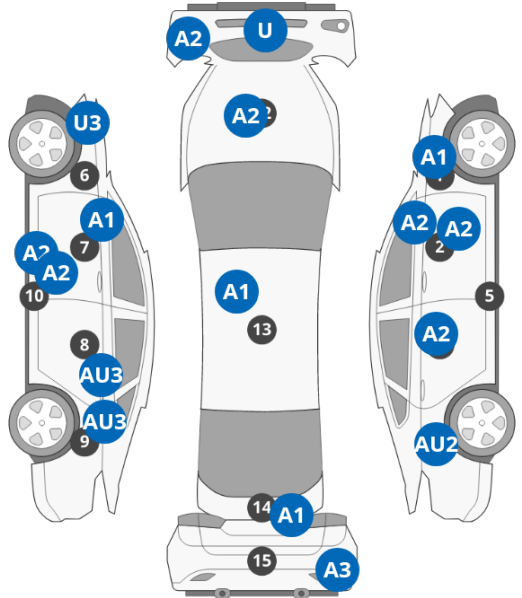
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.0	114	107	130
2	Boot Lid	121.3	120	113	131
3	Roof	102.4	100	99	103/108
4	Left Front Fender	98.0	99	96	100
5	Left Front Door	100.1	100	103	97
6	Center Panel Left				
7	Left Rear Door	100.6	106	100	96
8	Left Back Panel	109.3	120	105	103
9	Right Front Fender	113.0	116	111	112
10	Right Front Door	117.3	120	117	115
11	Center Panel Right				
12	Right Rear Door	110.6	106	106	120
13	Right Back Panel	113.0	125	107	107

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Carpet - Worked - Large / (L) Front Trim - Worked - Small / (R) Front Trim - Grime - Small / (L) Front Seat - Worn - Yes / Ceiling - Grime - Medium	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal / Member (Bolted) - Dent - Yes
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet, jack and tools, no spare tire, with LTO plate, scratches on tail light, possible flooding, worn tires, rear left tire issue, front cross member and radiator cover painted red