

General Information

Date & Time: 01, Jun, 2026 15:19

Make	Toyota	Model	Veloz
YOM	2024	Odo Meter Reading	17,094
Registration No.	GBC5577	Chassis No.	MHFA1BY5R3085876
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



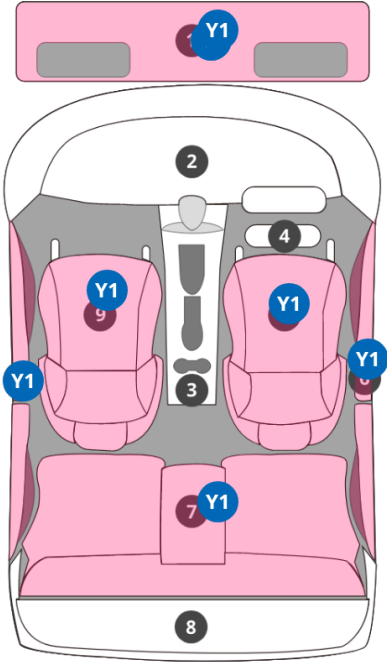
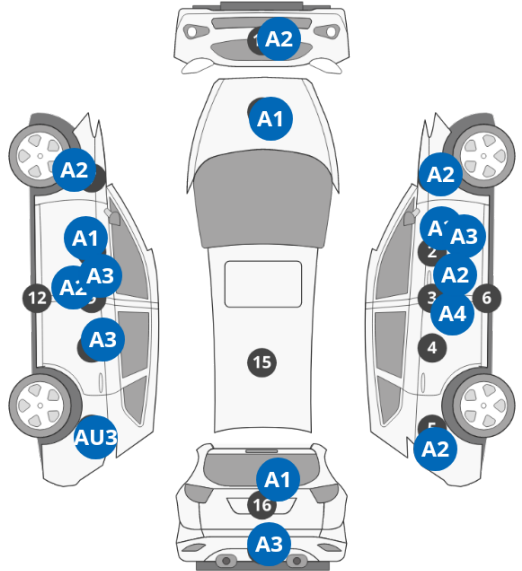
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.6	108	106	118
2	Boot Lid	111.3	113	113	108
3	Roof	137.2	141	141	130/137
4	Left Front Fender	122.3	123	122	122
5	Left Front Door	126.0	119	129	130
6	Center Panel Left				
7	Left Rear Door	121.6	126	118	121
8	Left Back Panel	133.0	129	138	132
9	Right Front Fender	127.6	130	129	124
10	Right Front Door	117.6	122	114	117
11	Center Panel Right				
12	Right Rear Door	117.3	121	119	112
13	Right Back Panel	138.6	127	142	147

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Minimal / Overall Interior - Animal Hair - Yes / Ceiling - Grime - Minimal / (L) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal	Remarks (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

Visible hairline scratches. Engine top cover missing. Incomplete tools. Without warranty booklet. With sparetire, seatcover, jack, LTO PPlate and 1key.