

General Information

Date & Time: 21, Feb, 2025 08:49

Make	Suzuki	Model	Carry
YOM	2023	Mileage	35,957
Registration No.	NHE6926	Chassis No.	MHYDC61TXPJ213459
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	White		

Body / Panel Condition



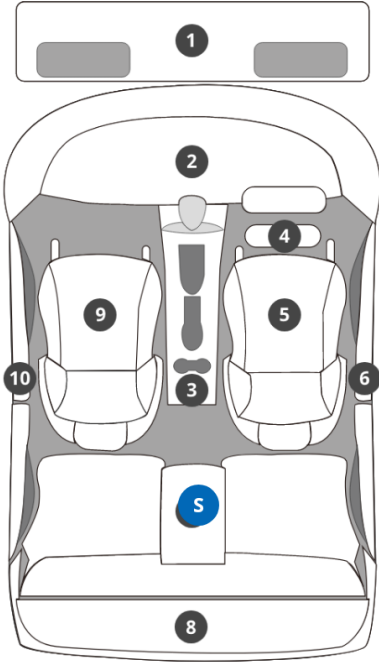
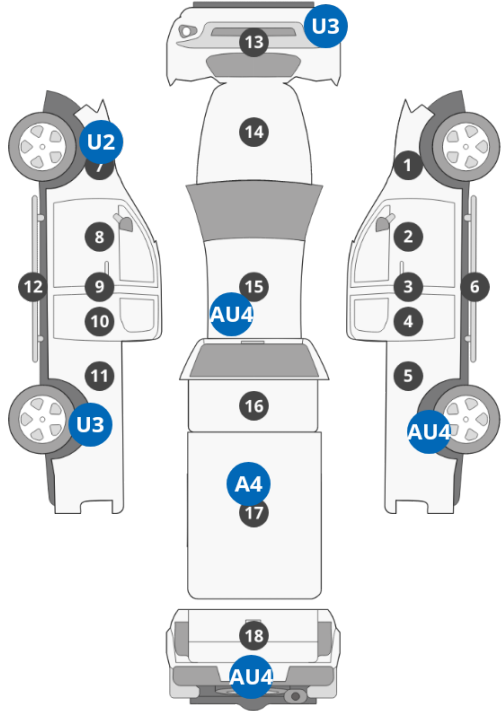
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.5	122	125	100
2	Boot Lid	108.4	119	92	114
3	Roof	121.6	127	105	86/169
4	Left Front Fender	122.6	117	116	135
5	Left Front Door	102.8	93	111	104
6	Center Panel Left	99.9	107	99	94
7	Left Rear Door				
8	Left Back Panel	140.3	136	136	149
9	Right Front Fender	118.6	112	120	124
10	Right Front Door	103.2	100	109	101
11	Center Panel Right	99.1	100	107	91
12	Right Rear Door				
13	Right Back Panel	133.3	148	125	127

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes	Remarks (L) Front Fender, Molding - Dent - Small / Front Bumper, Grille, Lamps - Dent - Medium / (R) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Side Gate - Dent - Medium / Cargo Bed Floor - Scratch - Large / Roof - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes

no warranty booklet/ no tools and jack / with LTO plate/ with spare tire/ with back glass