

General Information

Date & Time: 02, Jun, 2026 13:53

Make	Toyota	Model	Wigo
YOM	2023	Odo Meter Reading	39,270
Registration No.	FAN6437	Chassis No.	MHKA4DF5FNJ072626
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



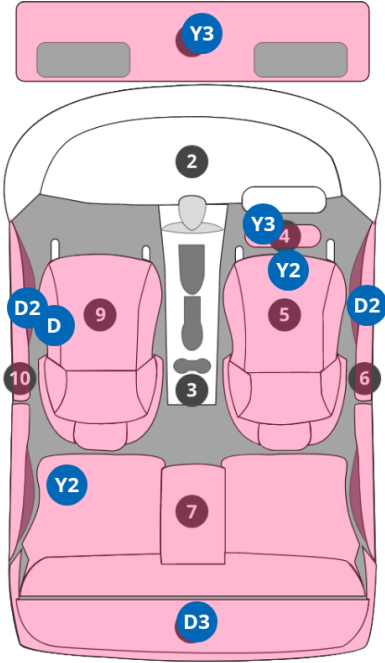
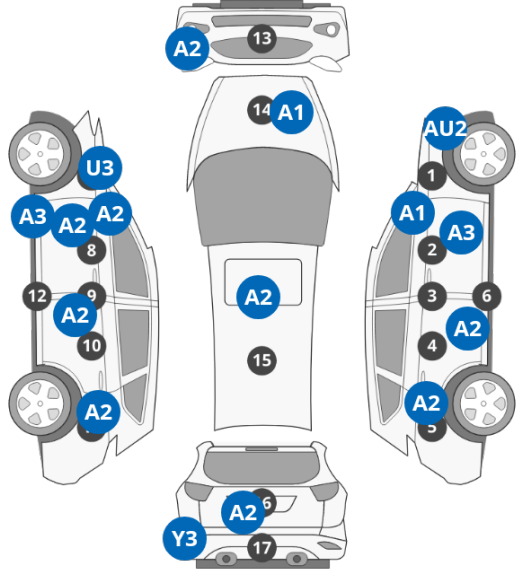
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.8	99	103	100
2	Boot Lid	108.6	110	110	106
3	Roof	98.3	85	88	92/128
4	Left Front Fender	113.3	118	108	114
5	Left Front Door	117.6	117	128	108
6	Center Panel Left				
7	Left Rear Door	115.3	111	119	116
8	Left Back Panel	107.0	100	119	102
9	Right Front Fender	119.3	123	131	104
10	Right Front Door	119.3	112	125	121
11	Center Panel Right				
12	Right Rear Door	111.0	94	120	119
13	Right Back Panel	115.0	111	108	126

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / (L) Front Floor Mat - Grime - Medium / (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Rear Seat - Grime - Small / Trunk Room - Loose, Deformed - Medium	Remarks (R) Rear Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Front Fender, Molding - Dent - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof Spoiler, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Remote Key & Smart entry - Issue - Yes / Parking Brake - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail light