

General Information

Date & Time: 24, Feb, 2025 09:53

Make	Toyota	Model	Rush
YOM	2021	Mileage	136,491
Registration No.	NGT1732	Chassis No.	MHKE8FF3PLK030722
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



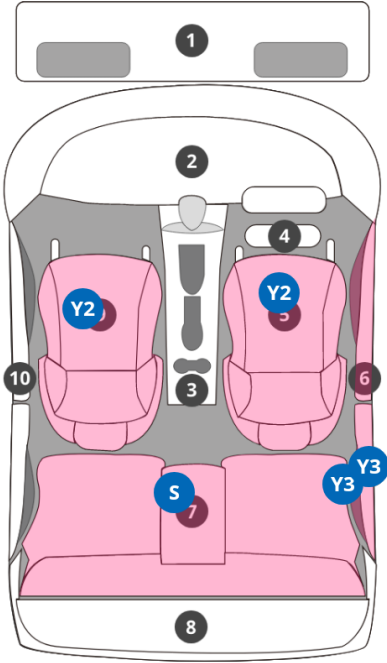
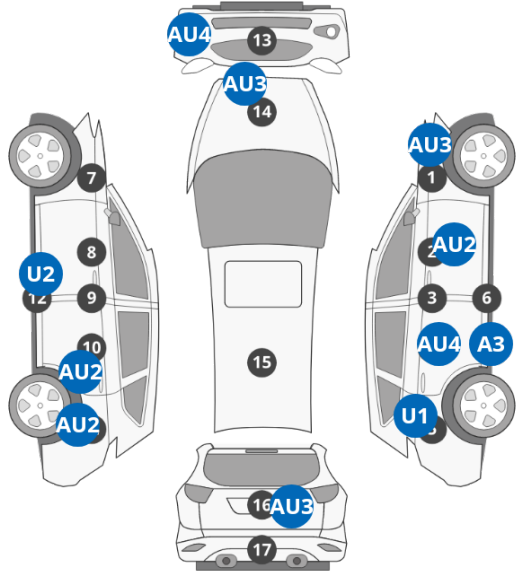
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.0	117	114	105
2	Boot Lid	104.3	106	104	103
3	Roof	99.1	92	83	113/109
4	Left Front Fender	100.3	104	108	89
5	Left Front Door	107.0	103	108	110
6	Center Panel Left				
7	Left Rear Door	106.0	110	108	100
8	Left Back Panel	102.6	100	108	100
9	Right Front Fender	105.6	104	105	108
10	Right Front Door	101.1	98	103	102
11	Center Panel Right				
12	Right Rear Door	102.1	99	100	107
13	Right Back Panel	103.3	118	95	97

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / Overall Interior - Worn as per age - Yes / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Rear Seat - Grime - Medium / (R) Rear Trim - Grime - Medium	Remarks Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Bonnet, Headlight - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Dent - Minimal
Frame Evaluation : B	Functional Evaluation : C
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Air Conditioner - Function - Weak / Parking Brake - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet/ no tools/ possible flooding/ with spare tire/ with LTO plate/