

General Information

Date & Time: 02, Jun, 2026 14:07

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	37,669
Registration No.	FAP8801	Chassis No.	PA1B18F3584194387
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



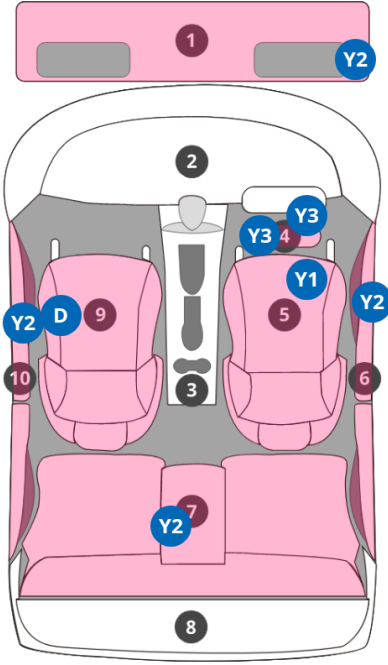
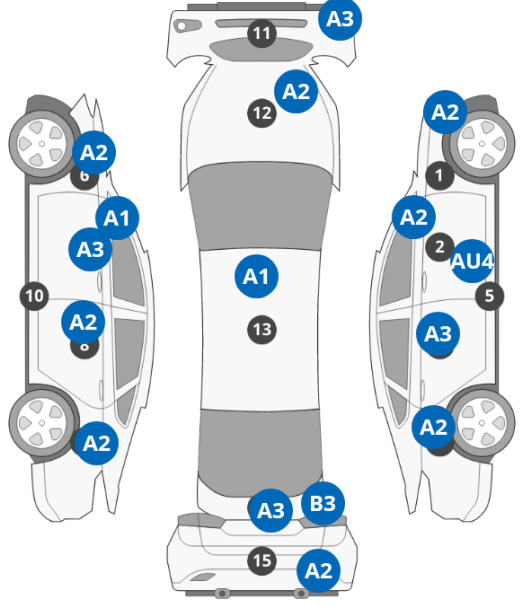
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.6	103	94	111
2	Boot Lid	107.0	108	101	112
3	Roof	95.1	106	96	86/93
4	Left Front Fender	103.6	109	101	101
5	Left Front Door	107.3	106	106	110
6	Center Panel Left				
7	Left Rear Door	108.3	109	108	108
8	Left Back Panel	106.3	114	100	105
9	Right Front Fender	100.4	101	98	102
10	Right Front Door	99.7	106	96	97
11	Center Panel Right				
12	Right Rear Door	93.9	89	93	100
13	Right Back Panel	95.7	92	94	101

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Medium / (L) Front Seat - Worn - Yes / (R) Front Floor Mat - Grime - Medium / Rear Seat - Grime - Small / (R) Front Seat - Grime - Minimal / Ceiling - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small	Remarks (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Modified - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty, no jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light