

General Information

Date & Time: 02, Jun, 2026 15:39

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	45,657
Registration No.	GAK6781	Chassis No.	PA1B18F38P4209550
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



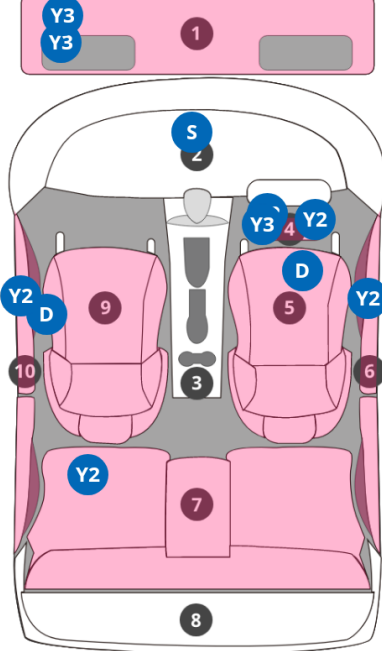
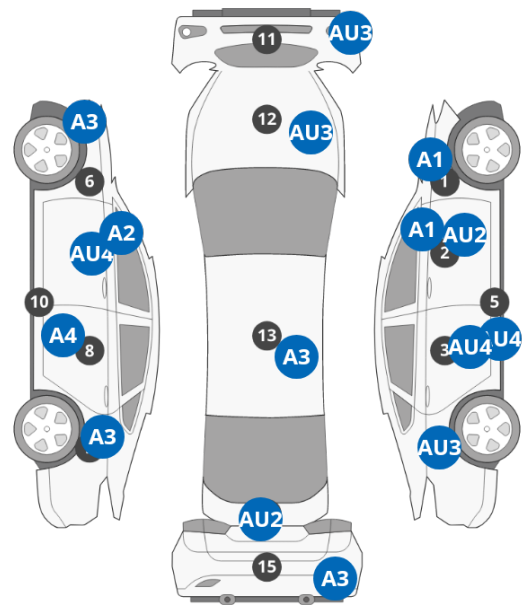
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	125.6	134	107	136
2	Boot Lid	151.6	146	170	139
3	Roof	115.7	116	120	121/106
4	Left Front Fender	109.0	109	109	109
5	Left Front Door	117.3	112	119	121
6	Center Panel Left				
7	Left Rear Door	125.6	137	128	112
8	Left Back Panel	138.3	134	131	150
9	Right Front Fender	114.3	113	118	112
10	Right Front Door	108.3	112	108	105
11	Center Panel Right				
12	Right Rear Door	118.6	110	119	127
13	Right Back Panel	115.6	112	111	124

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Grime - Medium / (L) Front Seat - Worn - Yes / Overall Interior - Smell - Yes / (R) Front Floor Mat - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Seat - Worn - Yes / Rear Seat - Grime - Small / Sunvisor, Sunglass Holder - Grime - Medium / Ceiling - Grime - Medium	Remarks (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Large / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch & Dent - Medium / Roof - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
no warranty booklet and tools, with jack, with spare tire, with LTO plate, scratches on tail light, possible flooding, most of the panel touched up marks