

General Information

Date & Time: 02, Jun, 2026 14:30

Make	Toyota	Model	Wigo
YOM	2022	Odo Meter Reading	54,342
Registration No.	GAR9424	Chassis No.	MHKA4DF5FNJ070375
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



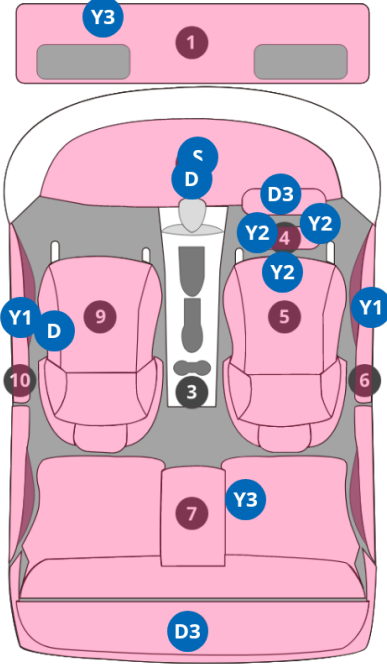
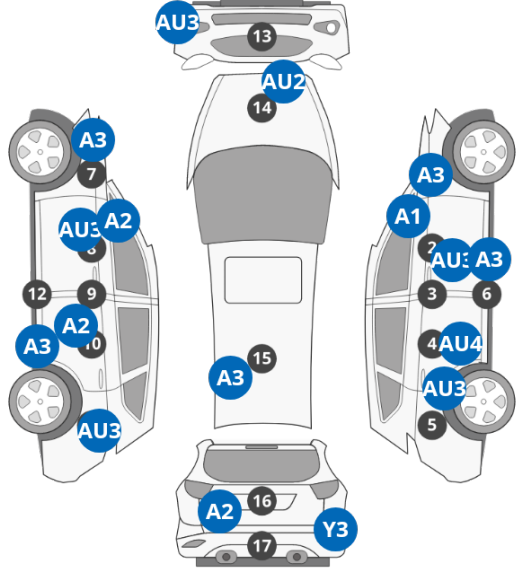
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	114	113	99
2	Boot Lid	99.2	92	95	110
3	Roof	108.6	111	114	113/97
4	Left Front Fender	106.6	112	113	95
5	Left Front Door	100.9	98	109	96
6	Center Panel Left				
7	Left Rear Door	113.3	114	112	114
8	Left Back Panel	103.1	113	99	97
9	Right Front Fender	111.6	113	112	110
10	Right Front Door	113.3	112	115	113
11	Center Panel Right				
12	Right Rear Door	113.6	112	114	115
13	Right Back Panel	95.8	100	99	89

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / Glove Box - Loose, Deformed - Medium / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Small / Trunk Room - Loose, Deformed - Medium / Ceiling - Grime - Medium / (L) Front Seat - Worn - Yes	Remarks (R) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Roof - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on headlight and tail light, suncrack taillight, check engine warning lamp ON, possible flooding, glove box issue, room mirror loose,