

General Information

Date & Time: 02, Jun, 2026 13:49

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	26,984
Registration No.	GBK9224	Chassis No.	PA1B18F39S4292768
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



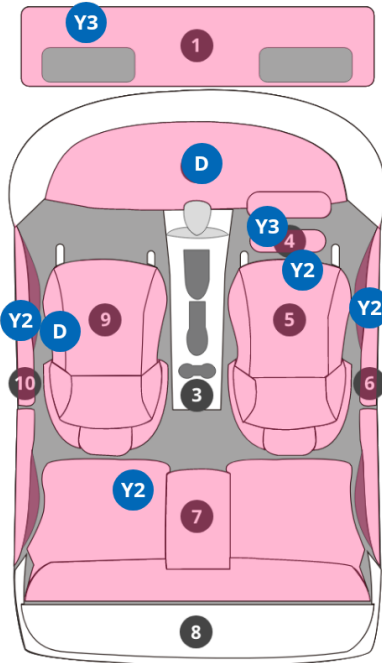
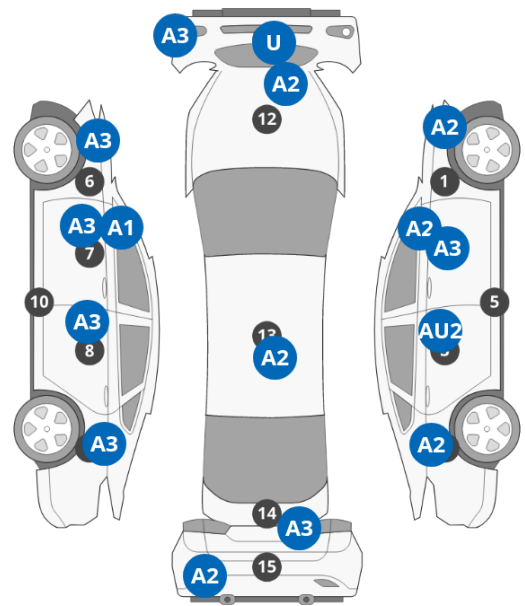
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	127.0	121	121	139
2	Boot Lid	134.3	132	128	143
3	Roof	111.5	109	121	105/111
4	Left Front Fender	111.0	111	111	111
5	Left Front Door	115.3	110	117	119
6	Center Panel Left				
7	Left Rear Door	116.3	122	117	110
8	Left Back Panel	119.6	124	122	113
9	Right Front Fender	114.0	105	108	129
10	Right Front Door	110.6	115	111	106
11	Center Panel Right				
12	Right Rear Door	106.6	108	104	108
13	Right Back Panel	109.0	112	106	109

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Medium / (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / Ceiling - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Small	Remarks Member (Bolted) - Dent - Yes / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

no warranty, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light, possible flooding