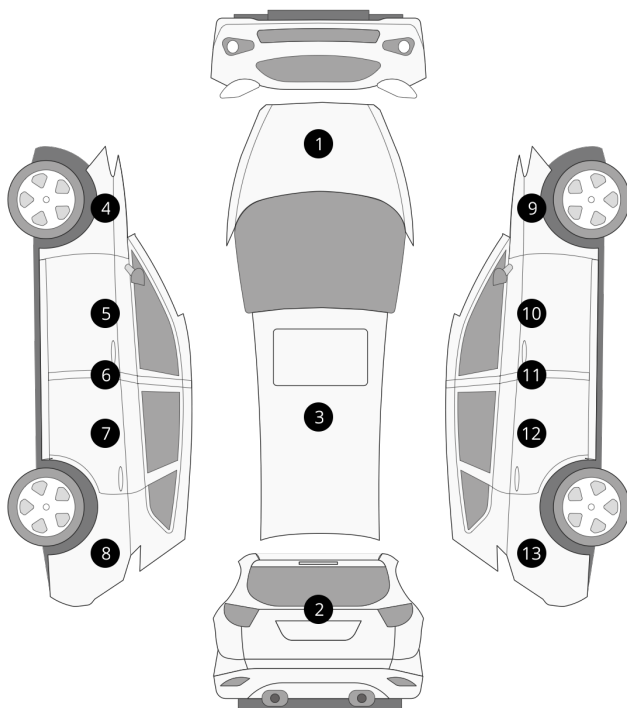


General Information

Date & Time: 02, Jun, 2026 15:36

Make	Toyota	Model	Avanza
YOM	2026	Odo Meter Reading	59,797
Registration No.	FAT9115	Chassis No.	MHFAA1BY7S0049214
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Green		

Body / Panel Condition



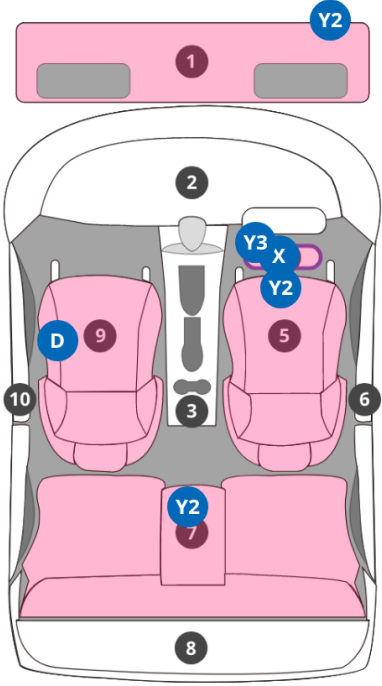
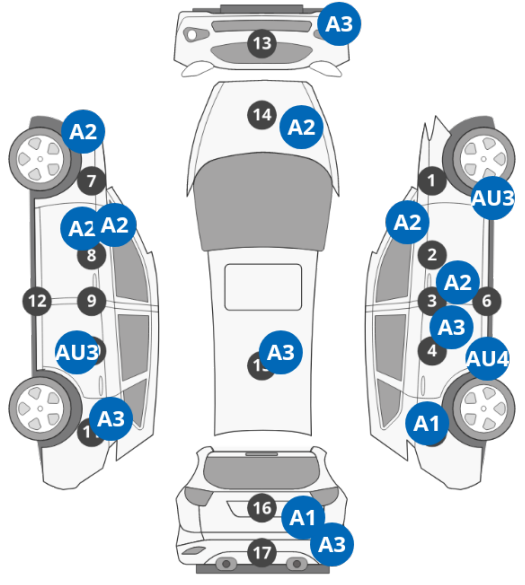
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.3	141	110	113
2	Boot Lid	115.6	107	112	128
3	Roof	127.2	141	135	113/120
4	Left Front Fender	110.0	121	104	105
5	Left Front Door	121.6	116	119	130
6	Center Panel Left				
7	Left Rear Door	122.0	127	124	115
8	Left Back Panel	126.0	128	111	139
9	Right Front Fender	109.6	109	112	108
10	Right Front Door	118.3	125	117	113
11	Center Panel Right				
12	Right Rear Door	128.0	160	111	113
13	Right Back Panel	120.0	132	107	121

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Missing - Yes / (L) Front Floor Mat - Grime - Medium / (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Small / Ceiling - Grime - Small / Rear Seat - Grime - Small	Remarks (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

with warranty booklet and jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light