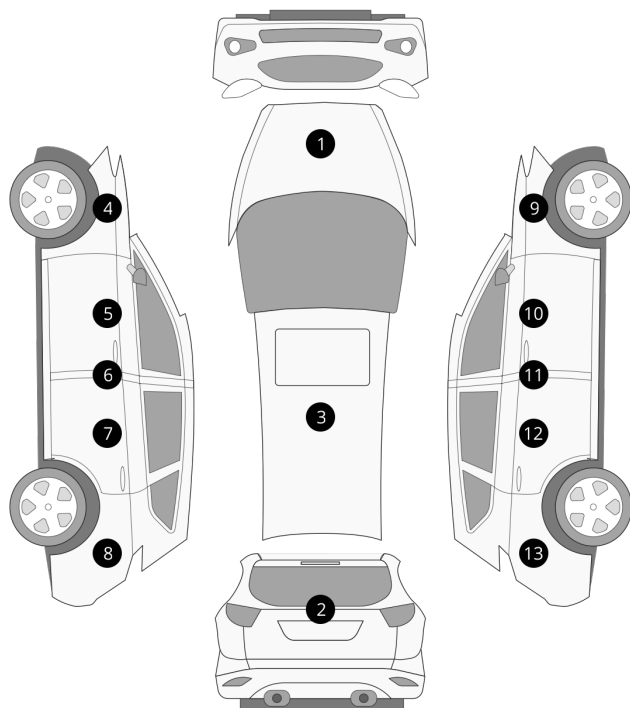


General Information

Date & Time: 25, Feb, 2025 18:25

Make	Toyota	Model	Vios
YOM	2021	Mileage	18,265
Registration No.	NGA9679	Chassis No.	PA1B18F33L4121810
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



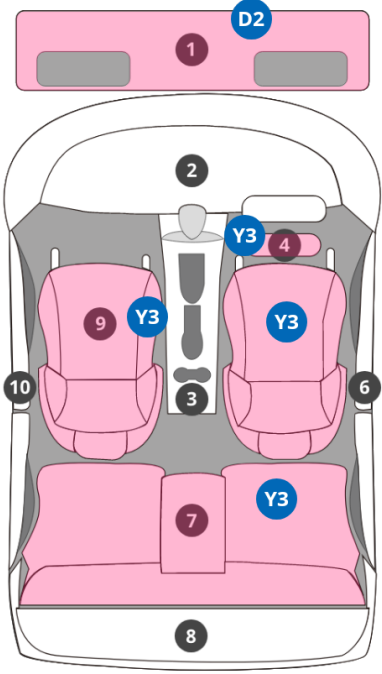
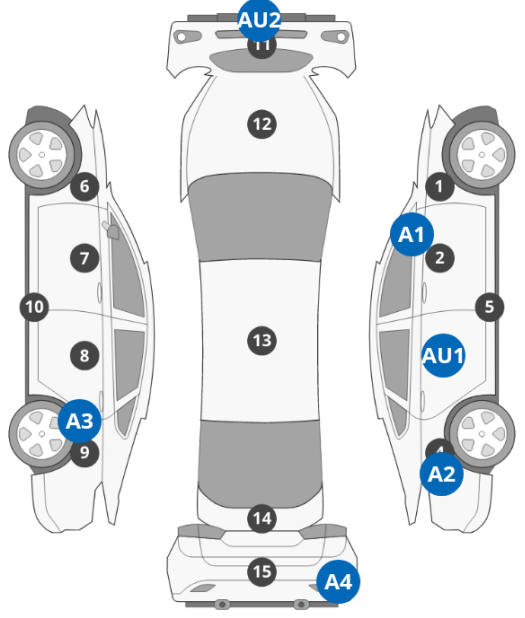
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.0	100	100	109
2	Boot Lid	96.7	95	93	102
3	Roof	86.8	96	76	86/90
4	Left Front Fender	92.0	94	94	88
5	Left Front Door	92.0	94	93	89
6	Center Panel Left				
7	Left Rear Door	91.3	91	94	89
8	Left Back Panel	230.0	231	229	230
9	Right Front Fender	83.6	84	84	83
10	Right Front Door	82.2	79	78	90
11	Center Panel Right				
12	Right Rear Door	91.0	92	94	88
13	Right Back Panel	88.6	88	87	90

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Crinkle - Small / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Floor Mat - Grime - Medium / (L) Front Seat - Grime - Medium	Remarks (L) Rear Fender - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
without spare tire, warranty booklet, jack and tools. with LTO plate.