

General Information

Date & Time: 04, Jun, 2026 14:24

Make	Toyota	Model	Raize
YOM	2023	Odo Meter Reading	80,053
Registration No.	FAN8856	Chassis No.	MHKAB1BA6NJ033523
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



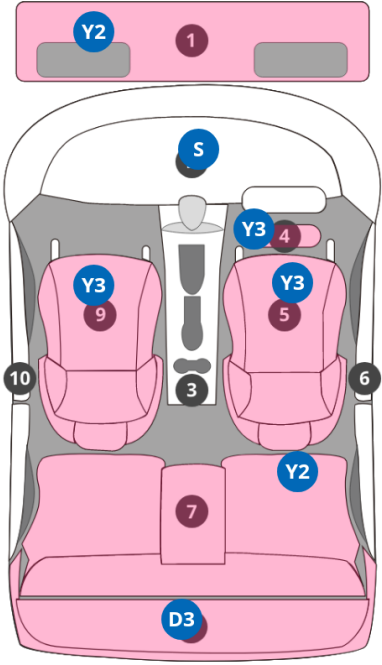
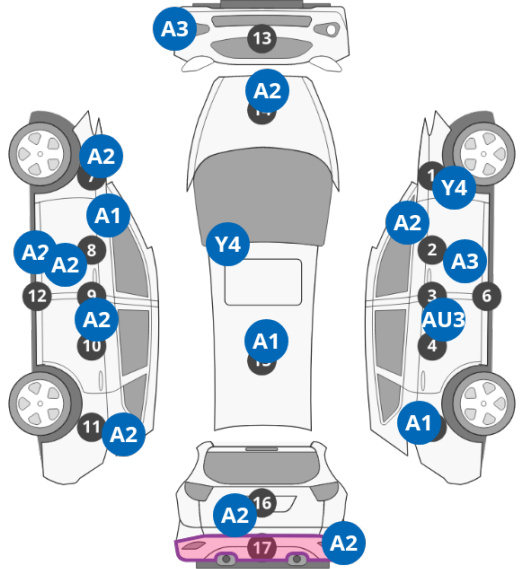
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.8	101	92	94
2	Boot Lid	87.7	85	97	81
3	Roof	104.1	103	112	96/105
4	Left Front Fender	150.3	161	156	134
5	Left Front Door	104.4	107	112	94
6	Center Panel Left				
7	Left Rear Door	100.3	101	101	99
8	Left Back Panel	92.3	93	94	90
9	Right Front Fender	93.7	91	99	92
10	Right Front Door	217.6	319	174	160
11	Center Panel Right				
12	Right Rear Door	269.0	163	232	412
13	Right Back Panel	80.0	84	81	75

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Loose, Deformed - Medium / Overall Interior - Smell - Yes / (L) Front Floor Mat - Grime - Medium / (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Medium / Ceiling - Grime - Small / Rear Seat - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Crack, Gap - Large / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal / Front Windshield - Damaged - Large / (R) Mirror - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet and tools, with jack, no spare tire, with LTO plate, scratches on headlight and tail light, fog lamp issue, rough idling, possible flooding, rear right wheel issue, cracked front windshield,