

General Information

Date & Time: 26, Feb, 2025 09:57

Make	Toyota	Model	Avanza
YOM	2023	Mileage	67,459
Registration No.	NHB4907	Chassis No.	MHFAA1BY6N0006780
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Red		

Body / Panel Condition



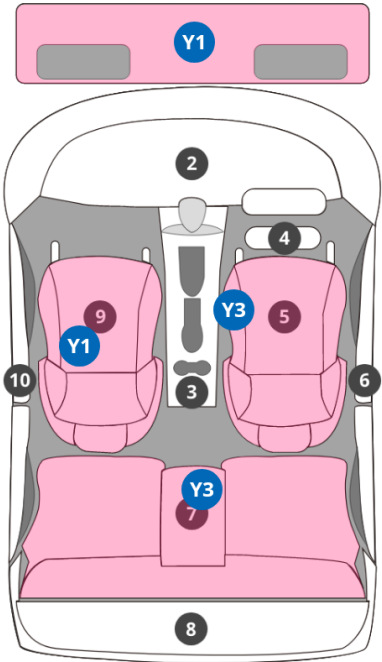
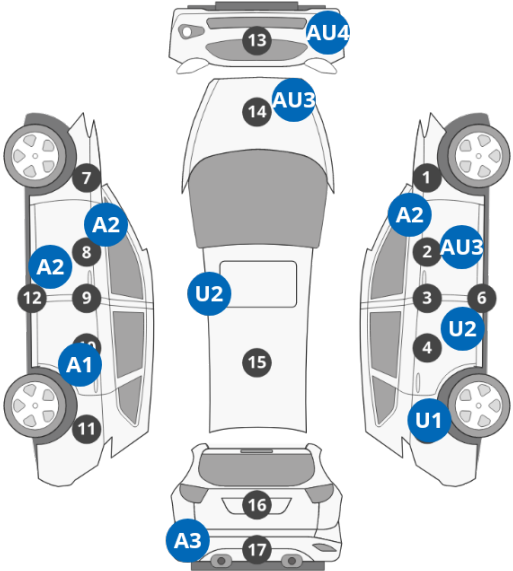
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	90.4	76	77	119
2	Boot Lid	102.9	100	116	93
3	Roof	106.0	109	116	99/100
4	Left Front Fender	209.6	229	195	205
5	Left Front Door	154.3	154	142	167
6	Center Panel Left				
7	Left Rear Door	97.7	104	95	94
8	Left Back Panel	101.3	106	100	98
9	Right Front Fender	71.8	74	69	73
10	Right Front Door	83.8	92	79	80
11	Center Panel Right				
12	Right Rear Door	143.6	134	145	152
13	Right Back Panel	99.0	93	99	105

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Minimal	Remarks Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Rear Fender, Molding - Dent - Minimal / Bonnet, Headlight - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Mirror - Scratch - Small / Roof - Dent - Small / (R) Rear Door, Molding - Dent - Small / (L) Rear Door, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
no right reverse light, Gap at the front bumper. with warranty booklet, spare tire and jack. no tools. with LTO plate.