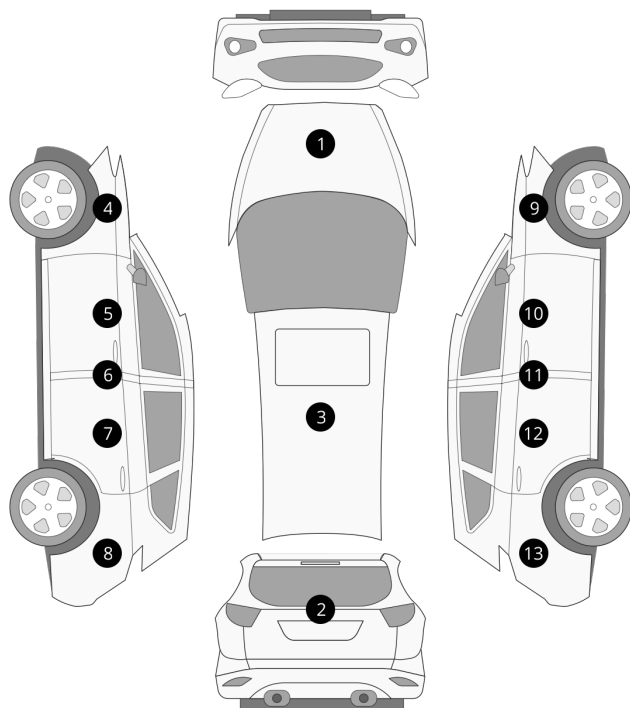


General Information

Date & Time: 21, Feb, 2025 15:28

Make	Toyota	Model	Vios
YOM	2023	Mileage	10,502
Registration No.	NIH4329	Chassis No.	PA1B18F31N4199375
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



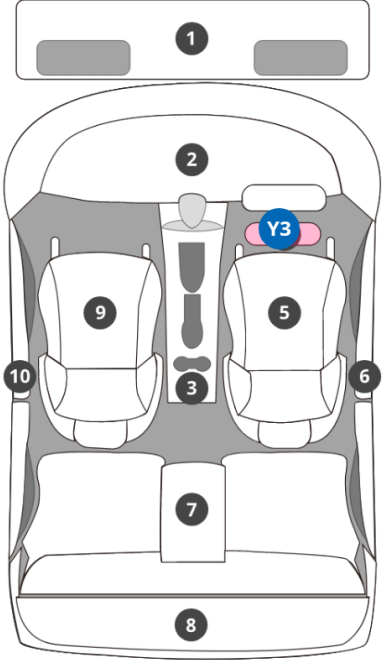
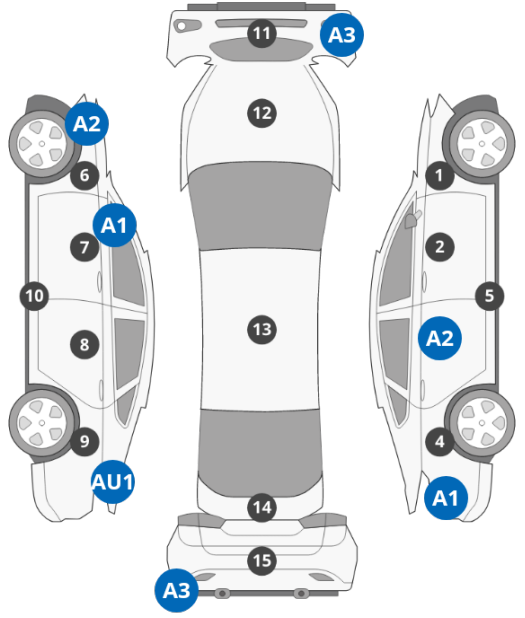
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.3	115	112	131
2	Boot Lid	108.3	105	105	115
3	Roof	98.3	98	99	95/101
4	Left Front Fender	92.3	92	93	93
5	Left Front Door	97.3	96	97	99
6	Center Panel Left				
7	Left Rear Door	98.6	97	99	100
8	Left Back Panel	102.9	111	100	98
9	Right Front Fender	97.7	94	103	96
10	Right Front Door	100.1	100	102	98
11	Center Panel Right				
12	Right Rear Door	95.2	88	98	99
13	Right Back Panel	98.2	91	97	107

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Grime - Medium	Remarks (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : D
Remarks Defects not found	Remarks Panel, Meter - Issue - Yes / Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Horn - Issue - Yes / Seat Belts - Issue - Yes

Inspector Notes

no warranty booklet, no jack, no tools, no spare tire, with LTO plate, crack on right tail light, air-conditioning system issue, horn issue, possible flooding/ trunk cover upper part missing/ hood cover missing/ radiator stay cover missing, seat belt issue