

General Information

Date & Time: 21, Feb, 2025 15:36

Make	Toyota	Model	Vios
YOM	2023	Mileage	47,530
Registration No.	CBI8699	Chassis No.	PA1B18F37P4224671
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



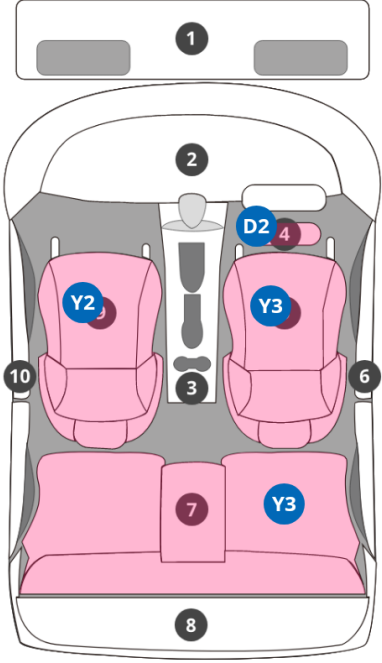
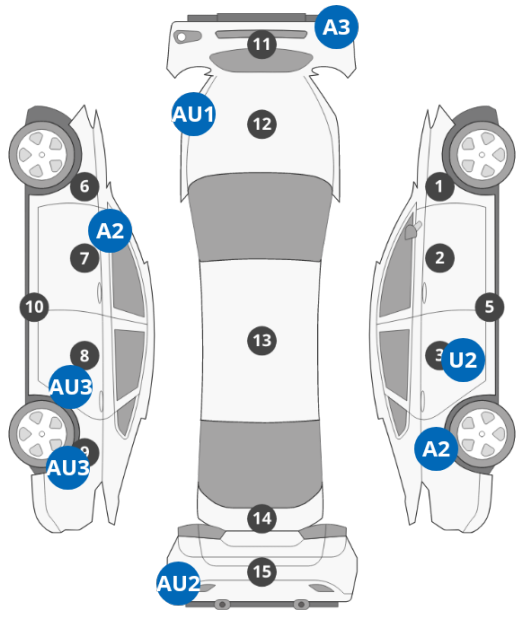
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.6	108	104	111
2	Boot Lid	113.3	109	118	113
3	Roof	105.2	108	101	106/106
4	Left Front Fender	96.2	97	98	94
5	Left Front Door	93.8	94	92	96
6	Center Panel Left				
7	Left Rear Door	101.3	105	101	98
8	Left Back Panel	103.6	104	102	105
9	Right Front Fender	155.3	177	150	139
10	Right Front Door	136.0	131	138	139
11	Center Panel Right				
12	Right Rear Door	103.0	104	100	105
13	Right Back Panel	97.8	99	94	100

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Rear Door, Molding - Dent - Small / Bonnet, Headlight - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with warranty booklet, spare tire and jack but incomplete tools. with LTO plate.